



# CORNER DATA FOR SURVEY OF SEC. 2 & 3, T. 16 S., R. 34 E., W.M., FOR THE U.S. FOREST SERVICE, GRANT CO., OR.

BY J&R SURVEYORS, P.O. BOX 418, DALLAS, OREGON  
SEE SHEETS 1 & 2 FOR MAP OF SURVEY. AUGUST '83


(A) Closing Corner Sec. 3 & 4:  
Found orig. stone & replaced w/ Alum. pipe & cap mkd. thus:  
Also fnd. 3 orig. BT's & mkd. 2 new ones as follows:  
10" W. Fir, S58°W, 34.1' to fc., 34.5' to center;  
11" L. Pine, S61°E, 28.7' to fc., 28.2' to center.  
Mag. Var. 17½°E.

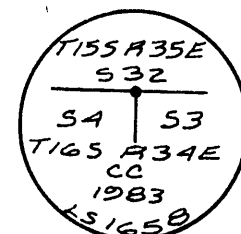


(B) Standard Section Corner, Sec. 32 & 33, T15S R35E:  
Found orig. stone & replaced w/ Alum. pipe & cap mkd. thus:  
Also fnd. NE Fir BT w/mks. but down & decayed & mkd. the following new trees;  
6" L. Pine, N41½°W, 24.2' to fc., 24.5' to center;  
10" Tamarack, N88°E, 28.5' to fc., 28.9' to center.

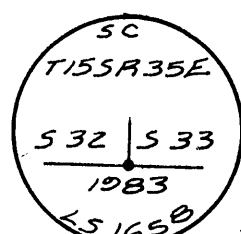


(C) North 1/4 Corner Sec. 3:  
No trace of orig post but set Alum. pipe & cap mkd. thus:  
Above pipe set from remains of roots of orig. 20" Pine.  
Also mkd. following new BT's;  
10" L. Pine, S83½°W, 93.1' to fc., 93.6' to center;  
8" L. Pine, S51°E, 10.9' to fc., 11.3' to center.  
Small Creek, brg. South is 24' West. (24.5')

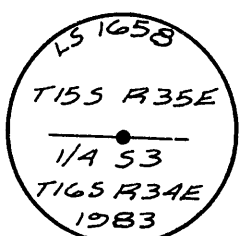


(D) Standard 1/4 Corner Sec. 33, T15S R35E:  
Found orig. stone & replaced w/ Alum. pipe & cap mkd. thus:  
The only orig. BT is now missing. Mkd. 2 new BT's thus;  
10" L. Pine, N76½°W, 30.2' to fc., 30.8' to center;  
9" L. Pine, N47½°E, 43.1' to fc., 43.6' to center.  
Mag. Var. 19°E.

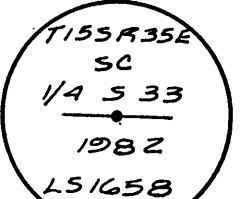


(E) Closing Corner Sec. 2 & 3:  
Found orig. stone & replaced w/ Alum. pipe & cap mkd. thus:  
Also fnd. orig. SE BT & mkd. 2 new ones as follows;  
12" L. Pine, S52 3/4°W, 144.8' to fc., 145.3' to center;  
22" L. Pine, S28°E, 69.2' to fc., 70.0' to center.

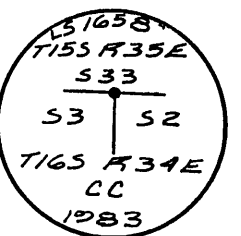

(F) Standard Section Corner, Sec. 33 & 34, T15S R35E:  
Found orig. stone & replaced w/ Alum. pipe & cap mkd. thus:  
Also fnd. remains of both Orig. BT's, both down, both w/mks.  
NE in position but position of NW tree could not be determined. Mkd. the following new BT's;  
6" L. Pine, N65 3/4°W, 140.6' to fc., 140.9' to center;  
12" P. Pine, N10°E, 160.1' to fc., 160.8' to center.  
Mag. Var. 18°E.

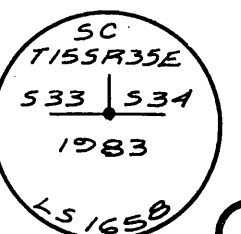


(G) North 1/4 Corner Sec. 2:  
Found orig. stone & replaced w/ Alum. pipe & cap mkd. thus:  
Also fnd. orig. BT to SW, alive w/closed fc., thus mkd. following new BT;  
8" W. Fir, S46½°E, 26.2' to fc., 26.5' to center.

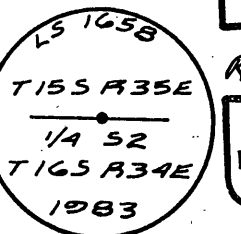


(H) Standard 1/4 Corner Sec. 34, T15S R35E:  
Fnd. orig. stone & replaced w/ Alum. pipe/cap mkd. thus:  
Also fnd. orig. NW BT alive w/closed fc. & mkd. one new one as follows:  
10" L. Pine, N66°E, 46.2' to fc., 46.7' to center;  
Mag. Var. 19°E.




(I) Closing Corner Sec. 1 & 2:  
No trace of orig. stone but from 3 orig. BT's set Alum. pipe w/ cap mkd. as shown at right.  
SE & NE BT's alive & in good condition w/ faces almost grown over so mkd. one additional BT as follows:  
6" W. Fir, S60½°W, 4.6' to face, 4.9' to center.

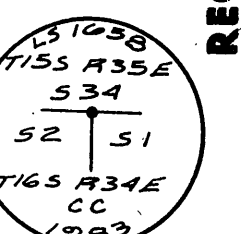


(J) One Quarter Corner:  
No trace of orig. stone or BT's found. Probably destroyed by road. At the proportion position I set an Alum. pipe w/ cap mkd. as shown at the right.  
Also mkd. the following new BT's:  
20" P. Pine, S85½°W, 34.9' to fc., 35.9' to center;  
8" W. Fir, S23°E, 82.0' to fc., 82.4' to center.  
Mag. Var. 18°E.

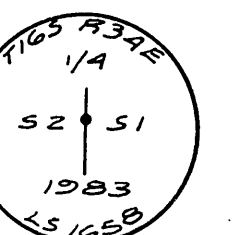


(K) Section Corner:  
Found orig stone disturbed. From 4 orig. BT's I set an Alum. pipe w/cap mkd. as shown at the right.  
The only orig. BT which appeared alive & healthy was the SW one thus I mkd. the following new ones:  
6" L. Pine, N12½°E, 6.9' to fc., 7.2' to center;  
8" W. Fir, S23°E, 35.6' to fc., 35.9' to center;  
20" Tam. N60 3/4°W, 42.1' to fc., 43.0' to center.  
Mag. Var. 18°E.

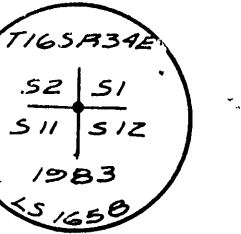


(L) One Quarter Corner:  
Found orig. stone I believe, but disturbed & w/ no marks.  
Fnd. the 2 orig. BT's, one broken of and the other one to the NW alive but thought it best to mark two new ones as follows:  
11" L. Pine, N00½°E, 20.2' to fc., 20.6' to center;  
7" P. Pine, S78½°E, 14.6' to fc., 15.0' to center.  
Mag. Var. 19°E. At true position I set an Alum. pipe w/ cap mkd. as shown at the right.

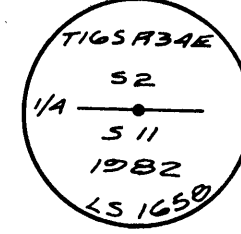


(M) Section Corner:  
Found Orig. stone but disturbed thus from roots of only remaining orig. BT to the SW, I set an Alum. pipe w/ cap mkd. as shown at the right.  
Also marked following new BT's:  
8" L. Pine, S36°W, 15.0' to fc., 15.4' to center;  
9" L. Pine, S52°E, 53.5' to fc., 54.0' to center;  
8" L. Pine, N78°E, 108.8' to fc., 109.2' to center;  
14" L. Pine, N23½°W, 159.1' to fc., 159.7' to center.  
Mag. Var. 19°E.

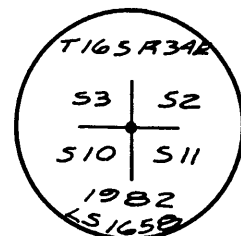


(N) East One-Sixteenth Corner:  
None set originally, at position midway between ¼ & Sec. Corner I set an Alum. Pipe w/cap 25" in the ground and marked as shown at the right.  
I also mkd. the following BT;  
14" L. Pine, S16°W, 113.7' to fc., 114.3' to center, mkd. "E 1/16 S10 BT", & brass washer mkd. LS 1658 at bottom of face. No trees in Sec. 3  
Set steel fence posts 5' N. & 5' W.

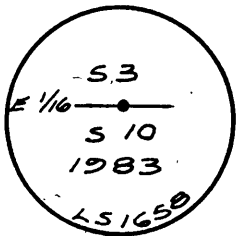


(P) One Quarter Corner:  
No trace of orig. stone or BT's, thus at proportion position I set an Alum. pipe w/ cap mkd. as shown.  
Also mkd. the following new BT's:  
10" L. Pine, N65 W, 81.8' to fc., 82.3' to center;  
14" L. Pine, S07½ E, 72.0' to fc., 72.6' to center.

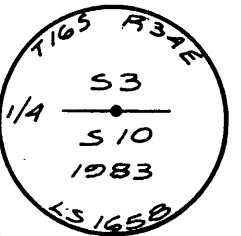


(Q) West One-Sixteenth Corner:  
Not set originally thus midway 1/4 cor. to sec. cor., I set an alum. pipe w/ cap 15" in ground & in stone mound & mkd. as shown at the right.  
Also mkd. the following BT's:  
9" L. Pine, N38°E, 55.7' to fc., 56.1' to center, mkd. "W 1/16 S3 BT";  
12" L. Pine, S44½°E, 30.5' to fc., 31.0' to center, mkd. "W 1/16 S10 BT".  
Both BT's have brass washer mkd. "LS 1658 @ bot./fc. Steel fence posts 5' N. & 5' E.

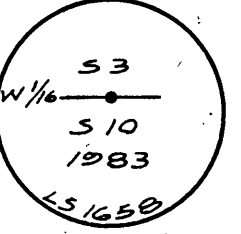


(R) Section Corner:  
Fnd. orig stone & replaced w/ alum. pipe w/ cap mkd. Also fnd all orig. BT's. NW & NE are alive & standing thus I mkd. the following new BT's:  
12" P. Pine, S43 3/4°W, 93.9' to fc., 94.4' to center;  
9" P. Pine, S78 3/4°E, 37.9' to fc., 38.2' to center.

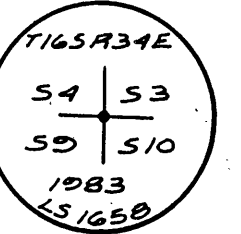


(S) One Quarter Corner:  
No trace of orig. stone or BT's ( area disturbed by dozing.) thus at the proportion position I set an Alum. pipe w/cap mkd. as shown at the right.  
Also mkd. the following new BT's:  
10" W. Fir, N36½°E, 36.9' to fc., 37.3' to center;  
9" L. Pine, N31°W, 58.2' to fc., 58.7' to center.

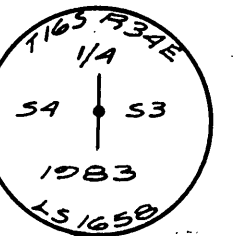


(T) Southwest One-Sixteenth Corner Sec. 3:  
Set Alum. pipe w/ cap 20" in grd., in mound of stone and mkd. as shown at the right.  
Also marked the following BT's:  
7" L. Pine, N12½°W, 29.2' to fc., 29.6' to center; mkd. "SW 1/16 S3 BT" & w/ Brass LS Washer @ bottom fc.  
8" Tamarack, S47½°W, 14.0' to fc., 14.3' to center, mkd. "SW 1/16 S3 BT" & w/ Brass LS Washer @ bot. fc.  
Steel fence posts 5' S. & 5' E.

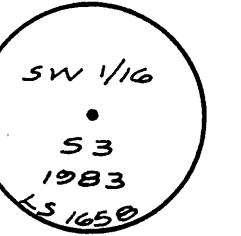


(U) Center-South One-Sixteenth Corner Sec. 3:  
Set alum. pipe w/ cap, 24" in the grd. mkd. thus: no stone for mound and no trees near.  
set steel fence posts 5' N. & 5' W.

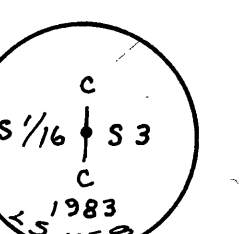

(V) Center One Quarter Corner Sec. 3:  
Set Alum. pipe w/ cap 24" in grd. in stone mound (small) and mkd. cap as shown at the right.  
Also mkd. the following BT's:  
6" L. Pine, S67½°W, 140.4' to fc., 140.7' to center, mkd. "C 1/4 S3 BT"; Brass LS Washer @ bot./fc.;  
6" L. Pine, S28½°E, 130.8' to fc., 131.1' to center, mkd. "C 1/4 S3 BT". Brass LS Washer @ bot./fc.;  
Set Steel fence post 5' North.

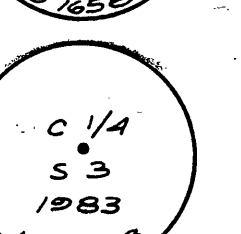


(W) Center-North 1/16 Corner Sec. 3:  
Set 2½"x30" Alum. pipe & cap 21" in the grd. in small stone mound and mkd. cap as shown at the right:  
Also mkd. the following BT's w/ "CN 1/16 S3 BT":  
14" L. Pine, N40½°W, 190.6' to fc., 191.3' to center;  
12" L. Pine, S41½°W, 87.4' to fc., 88.0' to center.  
Set steel fence posts 5' N. & 5' E. Area very boggy.

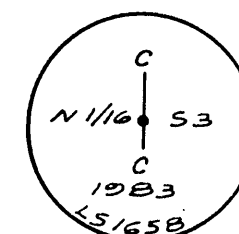

(X) Northeast One-Sixteenth Corner Sec. 3:  
Set Alum. pipe & cap 22" in grd. & in stone mound and mkd. cap as shown at the right:  
Also mkd. the following BT's w/ "NE 1/16 S3 BT";  
9" L. Pine, N49°W, 164.4' to fc., 164.8' to center;  
13" L. Pine, S49°W, 84.6' to fc., 85.2' to center.  
Set steel fence posts 5' North & 5' West.  
Small stream 15' East, Brg. SE.




(Y) One-Sixteenth Corner, NW Corner Lot 8, Sec. 3:  
Set Alum. pipe & cap 25" in grd. & in stone mound and mkd. cap as shown at the right:

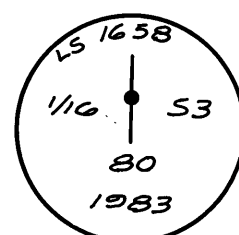


Also mkd. the following BT's. w/ "80 E 1/16 S3 BT";  
9" L. Pine, N65½°W, 79.1' to fc., 79.5' to center;  
16" L. Pine, N09½°E, 123.0' to fc., 123.6' to center.  
Set steel fence posts 5' E. & 5' S.


(Z) One-Sixteenth Corner, SE Corner Lot 1, Sec. 3:  
Set Alum. pipe and cap 23" in the grd & in stone mound and mkd. cap as shown at the right:  
No Trees near. Set steel fence posts 5' E. & W.

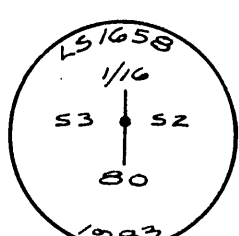


(AA) One-Sixteenth Corner, SE Corner Lot 4, Sec. 2:  
Set Alum. pipe & cap 23" in the grd. & in small stone mound and mkd. cap as shown at the right:  
Also mkd. the following BT's. w/ "W 1/16 S0S2 BT";  
10" L. Pine, N03°W, 99.8' to fc., 100.3' to center;  
12" L. Pine, S73½°W, 39.7' to fc., 40.3' to center.  
Set steel fence posts 5' W. & 5' S.

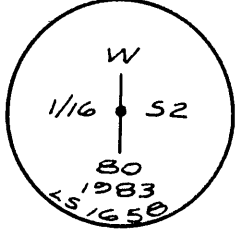


(BB) Center-West One-Sixteenth Corner Sec. 2:  
Set Alum. pipe & cap 20" in the grd. in stone mound and mkd. the cap as shown at the right:  
Also mkd. the following BT's. w/ "CW 1/16 S2 BT";  
12" L. Pine, S08°W, 54.2' to fc., 53.7' to center;  
9" L. Pine, N83°E, 79.1' to fc., 79.5' to center.  
Set steel fence post 5' North.

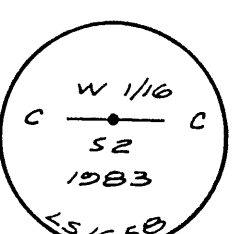


(CC) Southwest One-Sixteenth Corner Sec. 2:  
Set Alum. pipe and cap 22" in the grd. in stone mound and mkd cap as shown at the right:  
Also mkd. the following BT's. w/ "SW 1/16 S2 BT";  
7" L. Pine, S86½°E, 26.1' to fc., 26.4' to center;  
10" L. Pine, S20½°W, 35.1' to fc., 35.6' to center.  
Set steel fence posts 5' N. & 5' W.

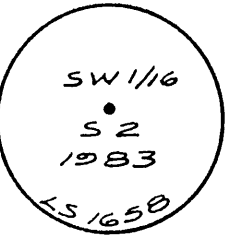


(DD) South One-Sixteenth Corner Sec. 3 & 2:  
Set Alum. pipe & cap, 16" in the grd. in stone mound and mkd. cap as shown at the right:  
Also mkd. the following BT's;  
18" L. Pine, N06½°W, 79.7' to fc., 80.5' to center, mkd. "S 1/16 S3 BT";  
18" L. Pine, N87°E, 29.3' to fc., 30.1' to center, mkd. "S 1/16 S2 BT".  
Set steel fence posts 5' West & 5' East.

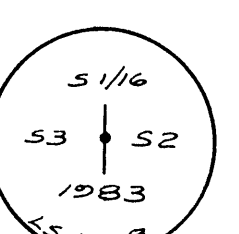

(EE) One Quarter Corner Common to Sec. 3 & 2:  
No trace of orig. stone, probably removed by ranching activities or could have sunk into the boggy area it falls in. I probed area for said stone to no avail.  
At the proportion position I therefor set an Alum. pipe & cap 24" in the grd. mkd. as at the right:  
No stone or trees available this area.

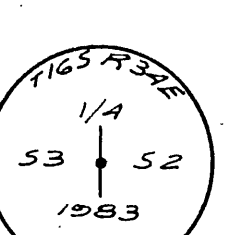

(FF) Southeast One-Sixteenth Corner Sec. 3:  
Corner point falls in Creek (10' wide) thus I set an Alum. pipe and cap 26" in the grd. & in small stone mound about 5' from waters edge on the East bank of said creek as a Witness Corner to the true Corner, and mkd. the cap as shown at the right:  
No trees are near this corner.  
Set Steel fence posts 5' E. & W. of the Witness Corner and also one on the South bank on the line going South from the true point in creek.  
Creek bears S40°W.

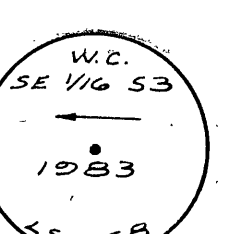

1/4 #8339