


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. A-7

History of original corner establishment:

In May 1873, under G.L.O. contract No. 185, W.W. Byars set stone 12x12x8 for 1/4 Sec. Corner.

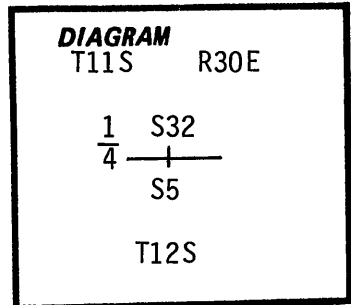

Description of corner evidence found:

Could find no evidence of original stone. Found location tag on 8" Fir reading "Appx 1/4 Cor. 23'" Found wood post rotted at 23' from location tag but no evidence of original stone.

Description of monument and accessories I established to perpetuate the original location of this corner:

At a point established by single proportioning between the original corner evidence found at the S.W. Corner of S31, T11S R30E and the original corner evidence found at the S.E. corner of S33, T11S, R30E and calculating for the curvature of the earth as per the BLM Manual of Surveying instructions 1973 paragraph 5-31, set 2 1/2"x30" aluminum pipe with 3 1/4" cap stamped:
Set pipe 24" in ground with mound of stone to cap.

T11S R30E
S32
1/4 S5
T12S
1981
OR PLS 1294

Bearing trees:

A Grand Fir 11" dia. bears N57°E, 37.0 ft. scribed 1/4 S32 BT.

A Grand Fir 10" dia. bears S54°E, 24.0 ft. scribed 1/4 S5 BT.

Attached 54-3 and 54-4 signs to both BT's, and brass washer stamped LS 1294 to foot blaze of both BT's. Painted blazes and 6" band around both BT's red. Attached 54-4 sign to metal post 6 feet East of corner.

Magnetic Declination = 19°30'E

I hereby certify the above corner monument was reestablished as herein described on September 17, 1981.

Witnesses: R. Orton
G. Orton

Office of..... County Surveyor..... County of..... Grant
State of..... Oregon....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 1982
Howard Bager by.....
(COUNTY OFFICIAL) (DEPUTY)

