


CORNER RESTORATION

CORNER: N1/4 Cor. Sec. 35 Twp. 12 S. Range 33 E., W.M.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

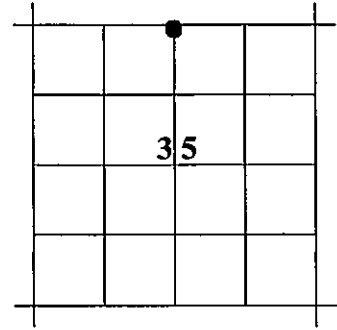


ORIGINAL DESCRIPTION: Set Stone 14x11x7 for 1/4 Sec corner.

RESTORATION BY, STAMP AND DATE:

Michael C. Springer, PLS

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

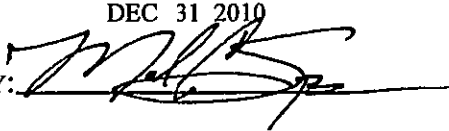DEC 31 2010
BY: 

REGISTERED
PROFESSIONAL
LAND SURVEYOR


OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2012

December 31, 2010

EVIDENCE FOUND: After a diligent search, I determine this corner to be lost. I set the new monument by single proportionate measure between the controlling corners at the NW and NE Corners of Sec. 35. See record Map of Survey No. 1910.

AT THE CORNER POINT: I set a 5/8"x30" iron pin, with attached 2" aluminum cap. Pin is driven 30" in the ground. I did not build a mound of stone as the monument is in a field that is driven across frequently. I placed a 5' fiberglass marker next to the monument. Cap is marked as shown hereon.

FROM WHICH I SET THE FOLLOWING REFERENCE POINTS:

A 5/8"x30" iron pin bears N.58°44'E., 25.39 ft. with attached 1 1/4" yellow plastic cap marked "BENCHMARK SURVEYING"

A 5/8"x30" iron pin bears S.28°31'E., 28.24 ft. with attached 1 1/4" yellow plastic cap marked "BENCHMARK SURVEYING"

A 5/8"x30" iron pin bears S.53°09'W., 34.28 ft. with attached 1 1/4" yellow plastic cap marked "BENCHMARK SURVEYING"

A 5/8"x30" iron pin bears N.36°29'W., 27.23 ft. with attached 1 1/4" yellow plastic cap marked "BENCHMARK SURVEYING"

Used RTK GPS to measure to new reference points. Bearings are based on record Map of Survey No. 1910.

