


CORNER RESTORATION

CORNER: N1/16 COR. SEC. 24, TWP. 13 S., RANGE 26 E., W.M.

ORIGINAL SURVEY BY: NOT

CONTRACT NUMBER: PREVIOUSLY

CONTRACT DATE: ESTABLISHED

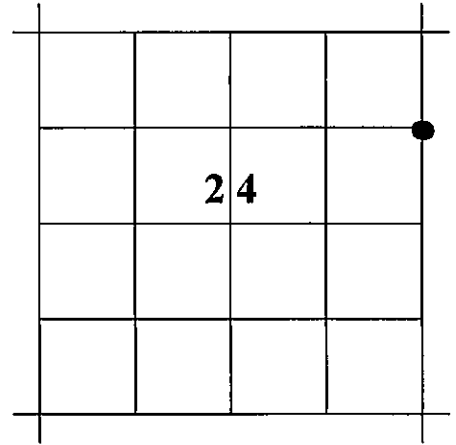

ORIGINAL DESCRIPTION: None

RESTORATION BY, STAMP AND DATE:

Michael C. Springer, PLS

RECEIVED AND
FILED

JUNE 30, 2010

OFFICE OF COUNTY SURVEYOR

ATTEST: *Robert D. Baya*

REGISTERED
PROFESSIONAL
LAND SURVEYOR

MCS

OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2012

June 24, 2010 SEE RECORD SURVEY NO. 1893

EVIDENCE FOUND: Corner not previously established

AT THE CORNER POINT: Set a 5/8"x10" iron pin with attached 2" aluminum cap, 8" into bedrock. Built a 1 foot mound of stone. Cap is marked as shown below.

FROM WHICH I SET THE FOLLOWING REFERENCE POINTS:

A 5/8"x30" iron pin bears N.12°44'E., 33.70 feet. with attached 1½" aluminum cap marked "BMLS SURVEY MARKER RP1 2010"

A 5/8"x30" iron pin bears S.32°49'E., 42.76 feet. with attached 1½" aluminum cap marked "BMLS SURVEY MARKER RP2 2010"

Used RTK GPS to measure to the reference points.

STATE PLANE COORDINATES: (3601 OR N)

Reference Datum: NAD83

Northing: 279,398.7 ft.

Easting: 8,455,152.0 ft.

Ellip Ht: 2,818.9 ft.

