

CORNER RESTORATION

CORNER: Section corner common to Sections 14, 15, 22 and 23
Township 17 South, Range 27 East,
Willamette Meridian

	2	2			2	3	

ORIGINAL SURVEY BY: Henry W. Cooke


CONTRACT NUMBER: 427

CONTRACT DATE: June 24, 1882

ORIGINAL DESCRIPTION: Set Juniper post with 4 pits with earth mound 2 feet high with 4½-foot base around post.

RESTORATION BY, STAMP AND DATE:

John G. Lawson
Mike Weisenborn

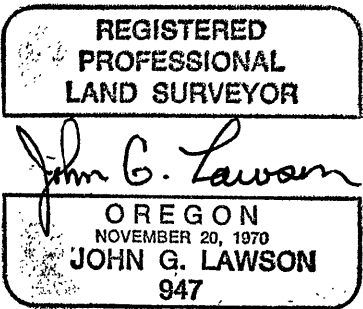


December, 1999

EVIDENCE FOUND: Izee County Road Plans in 1958 show this corner as a “found corner”. We re-established this corner by tying in the present county road centerline and overlaying the designed centerline and producing a “best fit”. From this, we replaced “corner found” with a 1” iron pipe with a brass cap. I checked with the county and state and there are no other records of the 1958 road survey. Jim Officer, a long time resident in the area, remembers an iron pipe at this location that was obliterated by farming activities. There is no remaining original evidence of this corner. However, we feel this position is within a couple of feet of the 1958 position.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

At the corner point, I set a 1” x 24” galvanized iron pipe, with a Brass Cap stamped as shown, 36” in the ground, in a field, 1 foot below surface.

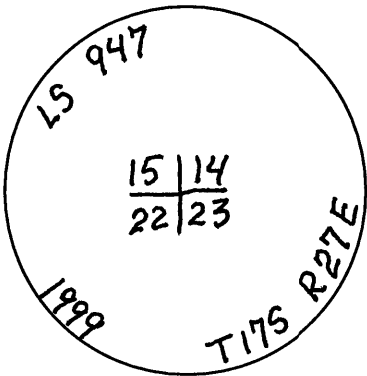

RECEIVED AND
FILED

APR 27, 2000
OFFICE OF COUNTY SURVEYOR
DAVID C. S. J.

From which:
Power pole: North 87°22’ West, 162.46 feet
Power pole: South 85°57’ West, 342.46 feet
5/8” iron rod with plastic cap (PI): North 64°45’03” West, 769.69 feet
5/8” iron rod with plastic cap (PI): North 22°46’28” East, 646.75 feet
compass with 20° East variation, and measured to the center of the power poles.