


CORNER RESTORATION

E $\frac{1}{4}$ corner
CORNER Sec. 24 TWP 18 S RANGE 28E

ORIGINAL SURVEY BY: Bamford Robb

CONTRACT NUMBER: 366

CONTRACT DATE: August 18, 1884

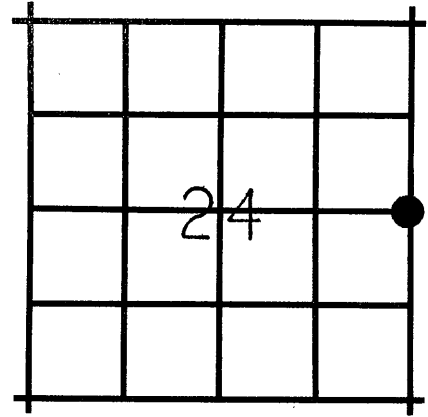

ORIGINAL DESCRIPTION:

North between Secs. 19 and 24.

40.0 set post for $\frac{1}{4}$ section corner with mound of stone

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
G. L. Earl

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

April 4, 1980

Grant County Surveyor

EVIDENCE FOUND:

At the corner point: Found remains of original corner post (rotten) after shaving away 4 inches of top soil. A dim mound of stone was scattered around post.

RECEIVED AND
FILED

APR 24 1980

OFFICE OF COUNTY SURVEYOR

Robert D. Bagett
Attest: *Lemmie L. Lawrence*

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: Set a $1\frac{1}{2}$ "x30" galvanized iron pipe 26 inches in the ground with brass cap marked as shown.

From which I scribe NEW BEARING TREES:

A 5" Juniper bears S. 88° W., 185.5 ft. mkd. $\frac{1}{4}$ S24 CSBT
An 8" Juniper bears S. 49° E., 178.2 ft. mkd. $\frac{1}{4}$ S19 CSBT

Buried remains of post in hole alongside iron pipe as a memorial.

A compass with 20° E. variation and steel tape was used measuring to the face of bearing tree blaze.

See Map of Survey No. 611.

MONUMENT MARKED

