

RECORD OF LAND CORNER MONUMENTATION


SOUTHWEST CORNER SECTION 2, T. 7 S., R. 28 E., W.M.

ORIGINALLY ESTABLISHED BY: Frank W. Campbell, U.S. Deputy Surveyor

CONTRACT NUMBER: 521

CONTRACT DATE: January 8, 1885

SUBSEQUENT SURVEYS: U.S.F.S. corner record (Form 7100-52), dated January 1975 and signed by T. Hollamon

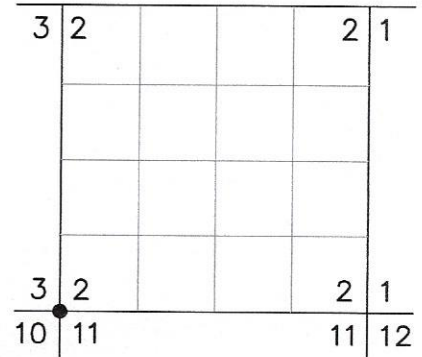

ORIGINAL DESCRIPTION: Set a basalt stone 14x8x6 ins 9 ins in the ground, for Cor. to Sec's 2, 3, 10 & 11, marked with 5 notches on S. and 2 notches on E. edges and raised a mound of stone alongside.

1975 DESCRIPTION: *DESCRIBE CORNER MONUMENT FOUND:* "Stone. Call size with marks, in fence Jack at gate. There are several mounds of stone in the area and I feel stone could very well have been moved (Duane Griffith)"
DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND: "There were no original B.T.s. Duane Griffith, Professional Land Surveyor, during the 1974 monumentation contract, declared evidence insufficient for monumentation."

EVIDENCE FOUND: Found stone 14"x7"x6" marked with 5 grooves on one face. The stone was found lying loose along an east-west fence approximately 6.5 ft. East of a gate post supported by a rock jack. I also found a Heppner Lumber Company K-tag lying on the ground, marked for the section corner, dated 4/6/1953 and containing the initials GRP and ALP with other fragmentary markings. The rock jack had recently been rebuilt, with the old materials being piled nearby. According to the 1975 U.S.F.S. corner record, the marked stone had been found in the rock jack at that time. During the course of my survey, I recovered acceptable evidence at the nearest 1/4 corners to the North, East, South, and West. I found that the gate post/rock jack position is harmoniously related to said corners, indicates reliance over time (at least 69 years), and represents the best available evidence of the original corner position.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

The corner point is occupied by a wooden gate post, where it is impracticable to set a monument. Therefore, I establish a witness corner on the south line of Section 2. At a point which is S.89°02'35"E., 10.00 feet from the true corner position, I set a 5/8"x24" iron pin 12" into a drill hole in bedrock, and attached a 3 1/4" USFS brass cap, marked as shown below. Raised a 3 ft. diameter mound of stone around the monument to top of cap.

From which, I SET NEW REFERENCE POINTS:

- ▶ A 5/8"x 20" iron pin driven to refusal, bears N.30°03'E., 26.60 ft., with attached 2" aluminum cap marked *RP 1 2022 PLS 69454*
- ▶ A 5/8"x 8" iron pin, set in a drill hole in bedrock, bears S.45°03'E., 22.10 ft., with attached 2" aluminum cap marked *RP 2 2022 PLS 69454*
- ▶ A 5/8"x 12" iron pin, driven to refusal, bears S.45°04'W., 35.86 ft., with attached 2" aluminum cap marked *RP 3 2022 PLS 69454*
- ▶ A 5/8"x 24" iron pin driven flush, bears N.31°55'W., 22.34 ft., with attached 2" aluminum cap marked *RP 4 2022 PLS 69454*

Deposited corner stone and K-tag North and alongside the iron pin. Used RTK GPS to measure reference points. Bearings are geodetic, derived by GPS observation at the corner. Also set an aluminum guard post West, 5.3 ft., in an east-west fence line, with USFS 54-2 and 54-9 signs attached.

CORNER MONUMENT MARKED:



RESTORATION BY, STAMP AND DATE:

Work Performed July 12, 2022 by:


Jason L. Hatfield, PLS
Daniel B. Lee

USDA FOREST SERVICE
NORTHEAST OREGON LAND ZONE
1550 Dewey Avenue, Suite A
Baker City, OR 97814
(541) 523-1283

**RECEIVED AND FILED
GRANT COUNTY SURVEYOR**

FEB 10 2023

BY:

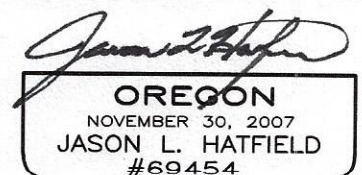

EXPIRES: 6/30/2023