CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

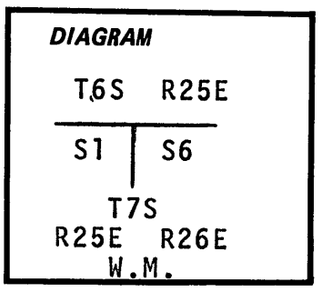

This corner was established in 1878 by Aaron F. York, under General Land Office Contract No. 309.

Surveyor General's record states:

Set stone 14" x 12" x 10" for corner, from which:

Tamarack 32" dia. bears North 15° East 28.38 feet (North 15° East 29.04 feet).
Fir 8" dia. bears North 12° West 37.62 feet (North 25° West 38.28 feet).
Fir 6" dia. bears South 81° East 19.80 feet (South 85° East 19.80 feet).
R. Fir 26" dia. bears South 8° West 11.88 feet (South 10° West 13.20 feet). (Edward W. Sanderson retracement record)

Description of corner evidence found:

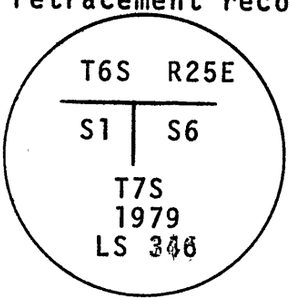

I found a 2" G.I. pipe with a 2-1/2" brass cap mkd: Exposed 3" from which:

A W. Fir 20" dia. with scribe marks T7 R2 visible in upper blaze which I opened bears South 85° East 19.8 feet (record South 85° East 19.8 feet (record South 85° East 19.8 feet).
D. Fir stump badly decayed bears South 10° West 13.2 feet (record South 10° West 13.2 feet).
W. Fir 21" dia. with healed blazes bears North 20° West 35.3 feet to center (record North 25° West 38.3 feet).
Tamarack sawed stump 30" dia. bears North 7° East 26.9 feet (record North 15° East 29.0 feet).
Tamarack 15" dia. scribed T7S R25E S1 BT in unhealed blazes and a LS 346 Tag in lower blaze bears South 50° West 31.6 feet.

Description of monument and accessories I established to perpetuate the original location of this corner:

D. Fir 15" dia. scribed T7S R26E S6 BT in unhealed blazes and a LS 346 tag in lower blaze bears South 34° East 14.9 feet.

Description of monument and accessories I established to perpetuate the original location of this corner:

I take a new bearing tree:

A W. Fir 8" dia. mkd T6S R25E S36 BT which bears North 34° West 27.2 feet to the center of tree at the lower blaze, in which I place a brass washer stamped LS 1679.

This perpetuation was done because it was apparent that all original bearing trees had not been recovered by the previous surveyor, and the bearing used was in error by approximately 10°. This was due to orienting on the Tamarack stump and not identifying the two remaining original Fir Bearing trees.

I hereby certify the above corner monument was perpetuated as herein described on November 6, 1980.

Witness: Bob Malotte

REGISTERED
PROFESSIONAL
LAND SURVEYOR
Kurt C Weaver
OREGON
JULY 14, 1978
KURT C. WEAVER
1679

Office of Surveyor County of Grant

State of Oregon, I hereby certify that the within instrument was filed in this office for record on the 10 day of Dec, 1980

Robert D Bayett by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

☆GPO—798-276

A-1