

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

INDEX No. G-17

History of original corner establishment:

Corner is originally established by
Bamford Robb, in 1881, under "General
Land Office" Contract No. 383.
Surveyor Generals Notes State:
Set basalt stone 15x8x6 for 1/4
Sec. cor. from which:

A fir 26 in dia. bears S12°E, 8 lks dist.
"Tamarack 14" " " S76°W, 5 lks dist.

DIAGRAM

T10S R29E
1/4
|
S10.S11
|
1986
PLS 848

Description of corner evidence found:

No trace of the original stone is found.

No evidence or trace of the original Bearing Trees
is found.

The corner area has been logged over and a stock water
pond constructed just west from the corner.

The Corner is determined to be lost to logging and
construction and is re-established by proportionate
measure, between Section Corners found 1/2 mi. North
and South.

**Description of monument and accessories | established to perpetuate the
original location of this corner:**

Set 2-1/2"x30" aluminum pipe with 3-1/2" aluminum cap, stamped as shown
on the **DIAGRAM**, SET 27" in the ground.



From Which.

A Fir 14" dia., Bears N40°W., 3.3 ft., scribed: 1/4 S10 BT

A Fir 10" dia., Bears S 7°E., 4.6 ft., scribed: 1/4 S11 BT

Measurements to trees taken with a metal tape and magnetic compass,
with Declination set off 20 deg. East.

Nailed a brass washer stamped PLS 848 on blaze above BT scribe, Bearing
Tree Sign above blaze, and warning sign on back of each tree. Painted
a 6" red band at breast ht. around each tree. Set steel fence post with
warning Sign, alongside pipe.

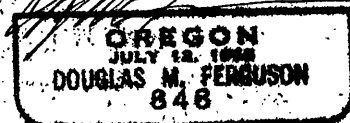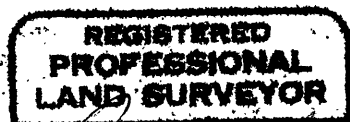

This work is performed by:
Douglas M. Ferguson PLS 848
Mt. Vernon Oregon.
On: April 14, 1986
Refer to Map of Survey No. 931

Office of Surveyor County of Grent
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 22 day of June, 1986
Robert D. Sagitt by _____
(COUNTY OFFICIAL) (DEPUTY)