

SEE GRANT

CERTIFIED RECORD OF LAND CORNER MONUMENTATION ~~RECORD~~ SURVEY

NO 1988
INDEX No. C-7

History of original corner establishment:

None. Corner was established as part of this survey.

DIAGRAM
T 10 S R 33 E
C 1/4 • S 5
PLS 1106
1989

Description of corner evidence found:

None.

Description of monument and accessories | established to perpetuate the original location of this corner:

At position established by survey... Set a 2½" x 30" aluminum pipe with standard ¾" USDA aluminum cap 22" in the ground and surrounded with a mound of earth only. Cap marked as shown in corner diagram.

New bearing trees established:


A 7" western larch brs N7½° E, 44.2' scribed C1/4S5 BT.

A 12" ponderosa pine brs N78 3/4° W, 85.2' scribed C1/4S5 BT.

New bearing trees have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-9 to each BT & painted face of blaze & 6" red band around each BT. Set steel fence post on National Forest Boundary W of corner & attached sign 54-2 and 54-9.

Compass declination 18° East.

I hereby certify that the above corner was properly established by me to U.S.F.S. standards and witnessed by Bill Quaempts on July 13, 1989.

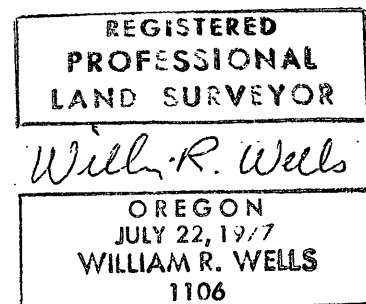

Office of... County Surveyor..... County of... Grant.....
State of... Oregon....., I hereby certify that the within instrument was filed in this office
for record on the... 29... day of... Mar... 1989...
..... by
(COUNTY OFFICIAL) (DEPUTY)