

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

SEE RECOF
SURVEY NO 1097

G-5

History of original corner establishment:


Corner originally established by Robb and Gradon under Contract No. 383 and dated March 26, 1881.

Original notes state:

Set stone 20 x 16 x 4 for 1/4 Sec Cor from which,

A pine 30 ins dia bears S20°E, 28 lks dist.

A pine 10 ins dia bears N38°W, 49 lks dist.

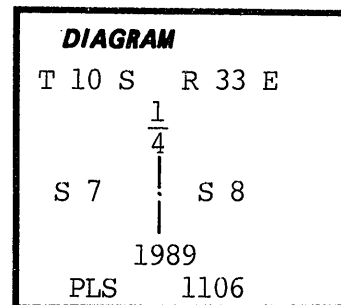

Description of corner evidence found:

The corner stone was not found as the corner area has been disturbed by logging & skid road constructed.

A 34" ponderosa pine brs S20°E, 18.5' to face of blaze and 19.5' to centerline with scribing visible on partially healed blaze (original bearing tree).

Description of monument and accessories | established to perpetuate the original location of this corner:

Re-established corner by measuring N20°W, 18.5' from face of blaze of found bearing tree...

Set 2 1/4" x 30" aluminum pipe with 2 1/2" aluminum cap 20" in ground and surrounded with a mound of earth and stone. Cap marked as shown in corner diagram.

New bearing tree established:

A 10" ponderosa pine brs S29 3/4°W, 59.9' scribed 1/4S7 BT.

New bearing tree has a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-9 to each BT & painted face of blaze & 6" red band around each BT. Set steel fence post South of corner and attached sign 54-9.

Compass declination 18° East.

I hereby certify that the above corner was properly re-established by me to U.S.F.S. standards and witnessed by Cliff Green on September 07, 1989.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of.....County Surveyor.....County of.....Grant
State of.....Oregon....., I hereby certify that the within instrument was filed in this office
for record on the 29 day of May, 1990
Robert D. Bazz by
(COUNTY OFFICIAL) (DEPUTY)