

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner **originally** established by Bamford Robb and Herman D. Graddon under joint GLO contract number 383 dated March 26, 1881
Surveyor General record states;

Set stone 16x10x9 ins for the $\frac{1}{4}$ sec cor from which;

A pine 10 in dia bears S45W 8 lks dist
A pine 10 in dia bears N45W 12 lks dist


Grant County survey number 63 by Duane I. Griffith in 1967 calls finding the original bearing trees and took an additional tree as follows;

A pine 7 in dia bears N53°E 61.5 lks dist marked $\frac{1}{4}$ S30 BT

Description of corner evidence found:

Found the original Southwest bearing tree and the bearing tree taken in 1967
(see below for description)

Found the original stone marked $\frac{1}{4}$ approximately 25 feet Northwesterly of the corner point in a burn pile

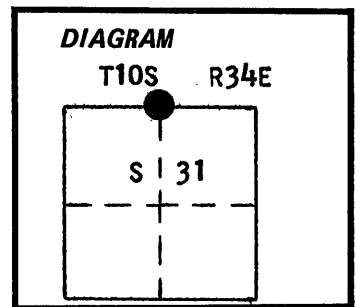

See map of Grant County survey number 928

Description of monument and accessories I established to perpetuate the original location of this corner: At record bearing and distance from the bearing trees I set a 2 $\frac{1}{2}$ 'x30" aluminum pipe with aluminum cap marked as shown, 28 inches in the ground from which:

Original bearing tree;

A 24 inch diameter P.Pine stump, cut high, bears S48°W 5.0 feet, blaze evident, did not open
No evidence of the original Northwest bearing tree

1967 bearing tree

A 12 inch diameter P.Pine bears N53°E 40.35 feet blaze evident, live and vigorous, did not open

New Bearing tree

A 8 inch diameter P.Pine bears S18°E 32.45 feet marked $\frac{1}{4}$ S31 BT


Raised mound of stone around monument

Buried the original stone North and alongside of monument

Set steel fencepost approximately 5 feet West with a 54-4 sign

Corner set March 27, 1986

Witnesses: Rick Robinson and Mark Bagett

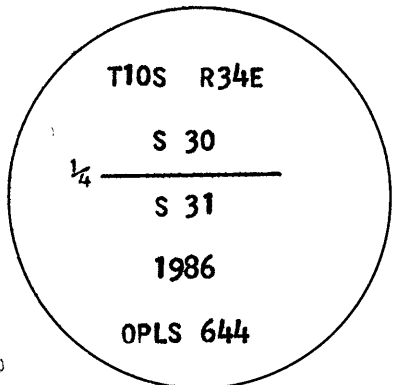

I used a steel tape and magnetic compass in the establishment of these accesories. I used 20° East magnetic declination and the distance to the original BT is to the face of blaze. The distance to the 1967 tree and the new BT are to a 50d spike driven in the right side of the BT at the root crown. I set a brass washer marked OPLS 644 by the BT blaze of the new BT

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 10, 1964
DUANE I. GRIFFITH
644

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 1986
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

☆ U.S. GOVERNMENT PRINTING OFFICE - 1983-793-276

SEE REMON FILED
NOV 29, 1967