


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. Z-25

History of original corner establishment:

Corner was originally established by Herman D Gradon under G.L.O. contract No. 416 during November, 1880. Surveyor General's notes state: "Set stone 14x12x6 in mound of stone for Standard cor. to secs. 36 and 31 Township 10S. Ranges 35 and 36 from which a pine 48 in. diam. bears N60°E, 42 lks. dist. A tamarack 28 in. diam. bears N20°W, 46 lks. dist. Country mountainous and heavily timbered with pine, fir and tamarack. Dense undergrowth of same and buckbrush."

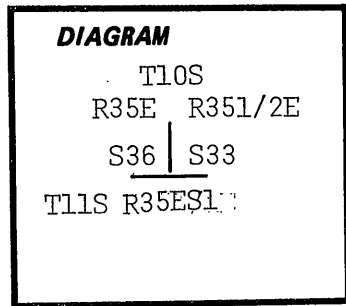

Description of corner evidence found:

Found no trace of corner stone as corner falls on new cut. Found BT recently burned by road crew. Found 36" stump hole and burnt BT tag.
Corner falls on steep road cut, about 50' North of highway.

Description of monument and accessories established to perpetuate the original location of this corner:

Measured S20°E, 30.4 ft. and set 2 1/2" X30" galvanized pipe and brass cap marked: Set pipe 25" in the ground and a few stones around.
From which by magnetic declination of N20°E:
A 16" Fir bears N73°W, 36.2 ft. scribed T10SR35ES36 BT. A 15" Fir bears N02°E, 67.8 ft. Painted blazes red and 6" red band around. Placed 54-3s, 54-4s and brass washers stamped PLS 1051 on BTs. Placed 54-4 on steel fence post 5' West of the corner.

T10S
R35E R351/2E
S36 | S33
T11S R35ES1
OR PLS 1051
1980

I hereby certify that the above corner monument was reestablished as herein described.

Witnesses: Robert Boling
Larry Shirley

July 21, 1980



Office of.....County Surveyor.....County of.....Grant.....
State of.....Oregon....., I hereby certify that the within instrument was filed in this office
for record on the.....28th.....day of.....January....., 1981.
.....Robert D. Sage.....by.....
(COUNTY OFFICIAL) (DEPUTY)