

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by Herman D. Gradon under GLO contract number 416, dated August 19, 1881. Surveyor General record states:

Set a basalt stone 12x8x6 ins 9 ins in the ground for $\frac{1}{4}$ Sec corner marked $\frac{1}{4}$ on W face from which:

A pine 30 ins diam bears N40°E 27 lks dist marked $\frac{1}{4}$ S BT
A pine 20 ins diam bears N60°W 30 lks dist marked $\frac{1}{4}$ S BT


A new corner was established by Vernon Glaze, Grant County Surveyor in 1914. His notes state:

North 2640 Est $\frac{1}{4}$ corner Secs 13-14 set iron post brass cap marked wooden post 4x4x4.0 scribed set stone 18x8x4 marked $\frac{1}{4}$ CS

No record of subsequent remonumentation was found in the Grant County Records.

Description of corner evidence found:

Did not find the original corner or the corner established by Glaze

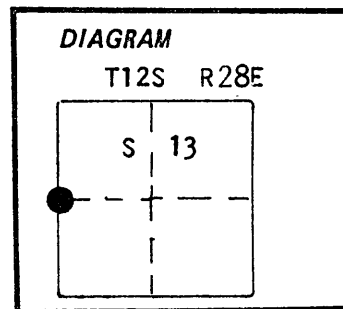

See map of survey dated January, 1985

Description of monument and accessories I established to perpetuate the

original location of this corner: At proportionate distance, I set a 2 $\frac{1}{2}$ inch x 30 inch aluminum pipe with aluminum cap marked as shown, 15 inches in the ground, from which:

New BTs

A 14 inch diameter Juniper bears S23°E 11.1 feet marked $\frac{1}{4}$ S13 BT

A 11 inch diameter Juniper bears S61°W 9.8 feet marked $\frac{1}{4}$ S14 BT

Raised mound of stone around monument


Set steel fencepost approximately 5 feet South with 54-4 sign attached

Corner set May 16, 1985

Witnesses: Greg Blackman and Rick Robinson

Note:

This corner was originally set in October of 1984, but prior to filing the above mentioned survey an error in the proportion was discovered. I moved the monument to the correct position on the above date. This is the reason for the cap being marked 1984.

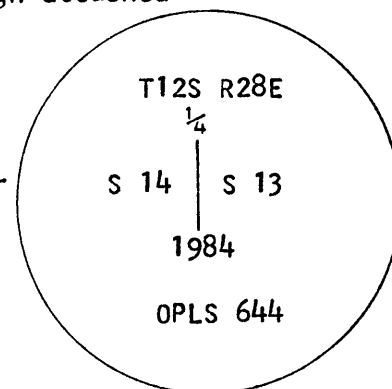

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JAN 10, 1984
DUANE L. GRIFFITH
644

I used a steel tape and magnetic compass in the establishment of these accessories. I used 20 East magnetic declination and the distance to the BTs are to the center of the tree. I set a brass washer marked OPLS 644 at the BT blaze. I painted a 6 inch red band around all BTs and attached 54-3 and 54-4 signs.

Office of.....*Surveyor*..... County of.....*Grant*.....
State of.....*Oregon*....., I hereby certify that the within instrument was filed in this office
for record on the.....*11* day of.....*June*....., 19.....*85*.....
Robert D. Regatt by.....
(COUNTY OFFICIAL) (DEPUTY)