


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by John B. David under GLO contract number 131 dated June 8, 1869. Surveyor General record states:

Set stone 20x10x6 for corner to Secs. 20,21,28 & 29

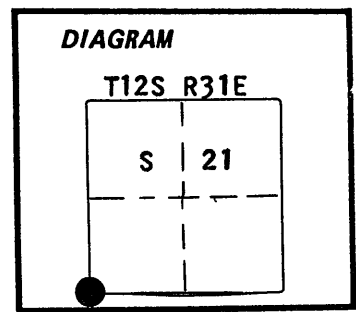

No record of subsequent remonumentation was found in the Grant County records

Description of corner evidence found:

Found stone 20x10x6 near an existing fence corner, loose on the ground with wire around it. A 20 inch diameter P.Pine with a blaze and scribing T12S R31E visible is the fence corner. I find remains of a mound of stone S70°E 5.6 feet from said tree. Due to the relative position of this mound of stone to corners to the North, East, South and West, I accept the mound of stone as the corner position.

See map of survey dated January, 1985

Description of monument and accessories I established to perpetuate the original location of this corner: At the above described position, I set a 2½ inch x 30 inch aluminum pipe with aluminum cap marked as shown, 26 inches in the ground, from which:

New BTs


A 10 inch diameter Red Fir bears N63°E 35.0 feet marked T12S R31E S21 BT
A 10 inch diameter Red Fir bears S59°E 22.9 feet marked T12S R31E S28 BT
A 11 inch diameter Red Fir bears S54°W 17.2 feet marked T12S R31E S29 BT
A 13 inch diameter Red Fir bears N61°W 36.2 feet marked T12S R31E S20 BT
(Unrecorded 25 inch diameter P.Pine bears N70°W 5.6 feet marked S20 T12S R31E

Buried the original stone North and alongside of the monument
Raised small mound of stone around monument

Set steel fenceposts approximately 5 feet West with 54-2 sign
and approximately 5 feet East with 54-2 and 54-4 signs

Corner set August 28, 1984

Witnesses: Mike Wagner and Jeff Meyerholz

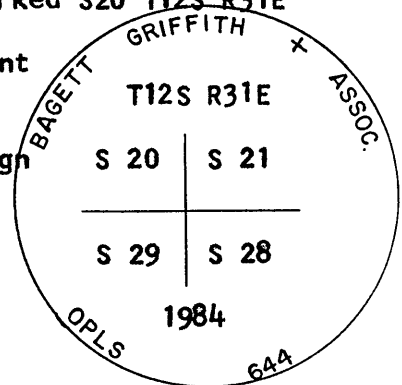

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 10, 1964
DUANE I. GRIFFITH
644

I used a steel tape and magnetic compass in the establishment of these accessories. I used 20° East magnetic declination and the distance to the BTs are to the center of the tree. I set a brass washer marked OPLS 644 at the BT blaze. I painted a 6 inch red band around all BTs and attached 54-3 and 54-4 signs.

Office of.....*Surveyor*..... County of.....*Grant*.....
State of.....*Oregon*....., I hereby certify that the within instrument was filed in this office
for record on the.....*11*..... day of.....*Feb*....., 19*85*.....
.....*Robert D. Baggett*..... by.....
(COUNTY OFFICIAL) (DEPUTY)