


CORNER RESTORATION

NW corner
CORNER Sec. 4 TWP 12 S. RANGE 33 E.

ORIGINAL SURVEY BY: Robb and Gradon

CONTRACT NUMBER: 383

CONTRACT DATE: March 26, 1881

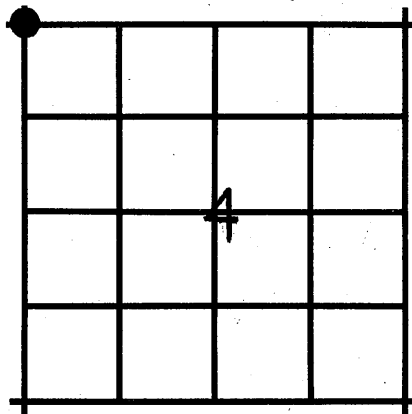

ORIGINAL DESCRIPTION:

80.00 set stone 22x12x10 cor cor. to Secs. 4, 5; 32 and 33, from which:

A Pine 14 inches in diam. bears N. 54° E., 29 lks. dist.

A Pine 14 inches in diam. bears S. 35° E., 33 lks. dist.

A Pine 20 inches in diam. bears S. 47° W., 46 lks. dist.

A Pine 22 inches in diam. bears N. 14° W., 28 lks. dist.

RECEIVED AND
FILED

AUG 11 1981

RESTORATION BY, STAMP AND DATE:

R. D. Baggett
W. A. Potridge
Dale Stennett

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Baggett

OREGON
JULY 12, 1963
ROBERT D. BAGGETT
598

OFFICE OF COUNTY SURVEYOR

Attest: *Carol Wright*
Co. Clerk

July 13, 1981

Grant County Surveyor

EVIDENCE FOUND:

I did not find the original corner stone. The corner stone was probably destroyed during logging operations some 30 years ago. I establish the corner at the intersection of distances from the original BT's in Secs. 4, 5 and 33. From the corner point: The Original Bearing Trees:

A 21" p. pine bears N. 58° E., 19.1 feet

with marks 3 BT visible in partially healed blaze.

A 21" pine stump bears S. 30° E., 21.8 feet

no marks remain on blaze.

A 24" p. pine bears S. 53° W., 29.8 feet

marked 3ES5B in partially healed blaze.

A 27" pine stump bears N. 10° W., 55.5 feet.

The blaze from this stump is 25 ft. Southwest and is on a 23"x6' log.

The weathered blaze on log is marked T11S R33E S3 T.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point:

Set a 1½"x30" iron pipe 26 inches into ground with brass cap marked as shown, from which I scribe NEW BEARING TREES:

A 3 in. diam. pine bears S. 49° E., 26.3 feet marked X CSBT.

A D. fir 7" in diam. bears N. 10° W., 27.8 ft. marked
T11S R33E S32 CSBT.

An unmarked stone 18x10x6 inches broken in half in a ring of smaller stones bears N. 44° E., 9 ft. I believe this stone and this ring of stones to have been placed here by some person in recent years. Certainly more recent than the original survey date. The position of these stones is not in harmony with the record and the original BT's, and I cannot accept it as being authentic. I placed the stones around the iron pipe.

This corner falls 15 feet South of a wire fence line that generally runs East and West.

Used a magnetic compass with a 20° East variation and steel tape measuring to the face of the BT blaze.

MONUMENT MARKED

