


CORNER RESTORATION

CORNER: SE Cor. Sec. 35 Twp. 12 S. Range 33 E., W.M.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

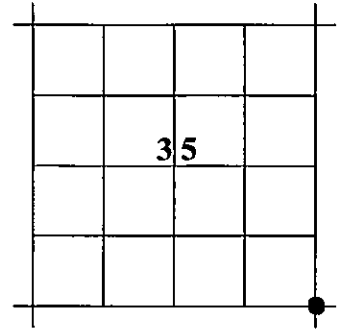


ORIGINAL DESCRIPTION: Set Stone 15x9x5 for corner to Secs 35 & 36

RESTORATION BY, STAMP AND DATE:

Michael C. Springer, PLS

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

DEC 31 2010

BY: 

REGISTERED
PROFESSIONAL
LAND SURVEYOR


OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2012

December 28, 2010

EVIDENCE FOUND: After a diligent search, I determine this corner to be lost. I set the new monument by single proportionate measure between the found controlling corners at the S1/4 Corner of Sec. 35 and the SE Corner of Sec. 36. See record Map of Survey No. 1910.

AT THE CORNER POINT: I set a 5/8"x20" iron pin, with attached 2" aluminum cap. Pin is driven 16" in the ground to solid bedrock. Built a 3 foot mound of stone. Cap is marked as shown hereon.

FROM WHICH I SET THE FOLLOWING REFERENCE POINTS:


A 5/8"x30" iron pin bears N.48°01'E., 29.09 ft. with attached 1 1/4" yellow plastic cap marked "BENCHMARK SURVEYING"

A 5/8"x30" iron pin bears S.34°33'E., 27.63 ft. with attached 1 1/4" yellow plastic cap marked "BENCHMARK SURVEYING"

A 5/8"x30" iron pin bears S.47°19'W., 29.15 ft. with attached 1 1/4" yellow plastic cap marked "BENCHMARK SURVEYING"

A 5/8"x30" iron pin bears N.36°58'W., 39.04 ft. with attached 1 1/4" yellow plastic cap marked "BENCHMARK SURVEYING"

Used RTK GPS to measure to new reference points. bearings are based on record Map of Survey No. 1910.

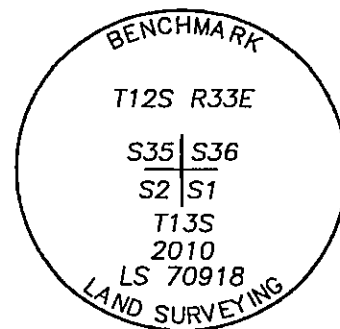

STATE PLANE COORDINATES: (3601 OR N)

Reference Datum: NAD83(CORS96) from OPUS solution

Northing: 300,149.9 ft.

Easting: 8,672,887.8 ft.

Ellip Ht: 3,868.7 ft.