CORNER RESTORATION

CORNER: NW Cor. Sec. 35 Twp. 12 S. Range 33 E., W.M.

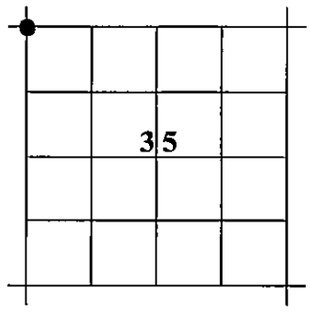

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

ORIGINAL DESCRIPTION: *Set Stone 15x10x8 for corner to Secs 26, 27, 34 & 35*

RESTORATION BY, STAMP AND DATE:
Michael C. Springer, PLS
Jason L. Hatfield, PLS

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

JAN 18 2011

BY:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2012

January 14, 2011

EVIDENCE FOUND: After a diligent search, I determine this corner to be lost. I set the new monument by double proportionate measure between the controlling corners at the SW Corner of Sec. 35 and the W1/4 Corner of Sec. 23 and between the N1/4 Corner Sec. 34 and the NE Corner Sec. 36. See record Map of Survey No. 1912.

AT THE CORNER POINT: I set a 5/8"x30" iron pin, with attached 2" aluminum cap. Pin is driven 28" in the ground. Built a 3 foot mound of stone. Cap is marked as shown hereon.

FROM WHICH I SET THE FOLLOWING REFERENCE POINTS:
A 5/8"x30" iron pin bears N.39°39'E., 27.90 ft. with attached 1¼" yellow plastic cap marked "BENCHMARK SURVEYING"
A 5/8"x30" iron pin bears S.64°07'E., 23.82 ft. with attached 1¼" yellow plastic cap marked "BENCHMARK SURVEYING"

ALSO FROM WHICH I MARK THE FOLLOWING BEARING TREES:
A juniper, 8 inch diam., bears S.03°20'W., 18.4 feet, marked T12S R33E S34 BT
A multi trunk juniper, 11 inch SE trunk bears N.39°00'W., 58.4 feet, marked T12S R33E S27 BT

Used RTK GPS to measure to new reference points and a steel tape to measure to BT's. Placed BT tags on trees. bearings are based on record Map of Survey No. 1912.

BENCHMARK
T12S R33E
S27 | S26
S34 | S35
2010
LS 70918
LAND SURVEYING

STATE PLANE COORDINATES: (3601 OR N)
Reference Datum: NAD83(CORS96) from OPUS solution
Northing: 305,341.8 ft.
Easting: 8,667,433.4 ft.
Ellip Ht: 3,870.3 ft.