CORNER RESTORATION

CORNER: W1/4 Cor. Sec. 35 Twp. 12 S. Range 33 E., W.M.

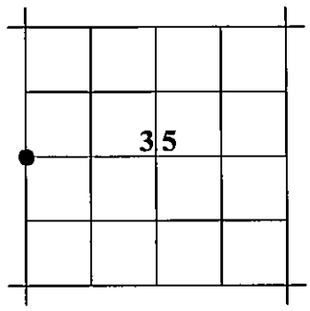

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

ORIGINAL DESCRIPTION: *Set Stone 18x9x8 for 1/4 Sec. Corner in Ravine bearing NE.*

RESTORATION BY, STAMP AND DATE:
Michael C. Springer, PLS
Jason L. Hatfield, PLS

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

JAN 18 2010

BY:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2012

January 14, 2011

EVIDENCE FOUND: After a diligent search, I determine this corner to be lost. We found no trace of the corner or the ravine called for in the original field notes. I set the new monument by single proportionate measure between the controlling corners at the SW and NW Corners of Sec. 35. See record Map of Survey No. 1912.

AT THE CORNER POINT: I set a 5/8" iron pin, with attached aluminum cap, 28 inches in the ground in a 3 foot mound of stone. Cap is marked as shown hereon.

FROM WHICH I SET THE FOLLOWING REFERENCE POINTS:
A 5/8"x30" iron pin bears N.67°05'E., 25.49 ft. with attached 1½" yellow plastic cap marked "BENCHMARK SURVEYING"
A 5/8"x30" iron pin bears S.34°27'E., 28.56 ft. with attached 1½" yellow plastic cap marked "BENCHMARK SURVEYING"
A 5/8"x30" iron pin bears S.73°03'W., 27.35 ft. with attached 1½" yellow plastic cap marked "BENCHMARK SURVEYING"
A 5/8"x30" iron pin bears N.33°47'W., 28.37 ft. with attached 1½" yellow plastic cap marked "BENCHMARK SURVEYING"

Used RTK GPS to measure to new reference points. Bearings are based on Record Map of Survey No. 1912, filed in the office of the Grant County Surveyor.

BENCHMARK
T12S R33E
1/4
S34 | S35
2011
LS 70918
LAND SURVEYING

STATE PLANE COORDINATES: (3601 OR N)
Reference Datum: NAD83(CORS96) from OPUS solution
Northing: 302,693.5 ft.
Easting: 8,667,483.6 ft.
Ellip Ht: 3,883.4 ft.