CORNER RESTORATION

CORNER: E1/4 Cor. Sec. 35 Twp. 12 S. Range 33 E., W.M.

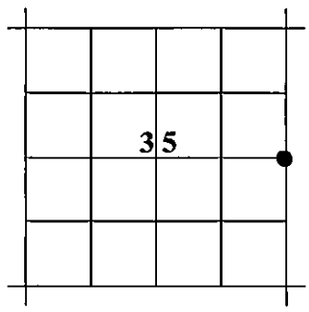

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

ORIGINAL DESCRIPTION: *Set Stone 16x10x7 for Sec corner.*

RESTORATION BY, STAMP AND DATE:
Michael C. Springer, PLS

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

DEC 31 2010

BY:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2012

December 29, 2010

EVIDENCE FOUND: After a diligent search, I determine this corner to be lost. I set the new monument by single proportionate measure between the controlling corners at the NE Corner of Sec. 35 and the SE Corner of Sec. 35. See record Map of Survey No. 1910.

AT THE CORNER POINT: I set a 5/8"x20" iron pin, with attached 2" aluminum cap. Pin is driven 16" in the ground to solid bedrock. Built a 3 foot mound of stone. Cap is marked as shown hereon.

FROM WHICH I SET THE FOLLOWING REFERENCE POINTS:
A 5/8"x30" iron pin bears S.60°47'E., 26.89 ft. with attached 1¼" yellow plastic cap marked "BENCHMARK SURVEYING"
A 5/8"x30" iron pin bears S.62°16'W., 33.22 ft. with attached 1¼" yellow plastic cap marked "BENCHMARK SURVEYING"
A 5/8"x30" iron pin bears N.41°21'W., 34.44 ft. with attached 1¼" yellow plastic cap marked "BENCHMARK SURVEYING"

ALSO FROM WHICH I SCRIBE THE FOLLOWING BEARING TREE:
A juniper, 4" diam., bears N.67°40'E., 41.6 ft. marked "1/4 S36 BT"

Used RTK GPS to measure to new reference points and a steel tape to the bearing tree. Placed BT tag on bearing tree. bearings are based on record Map of Survey No. 1910.

BENCHMARK
T12S R33E
¼
S35 | S36
2010
LS 70918
LAND SURVEYING

STATE PLANE COORDINATES: (3601 OR N)
Reference Datum: NAD83(CORS96) from OPUS solution
Northing: 302,796.5 ft.
Easting: 8,672,837.8 ft.
Ellip Ht: 3,964.7 ft.