CORNER RESTORATION

CORNER: SE 1/16 Cor. Sec. 35 Twp. 12 S. Range 33 E., W.M.

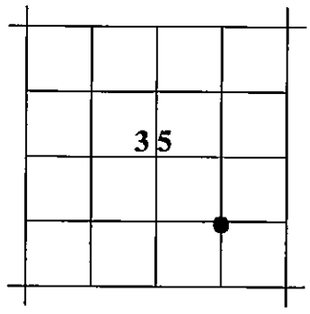

ORIGINAL SURVEY BY: NOT

CONTRACT NUMBER: PREVIOUSLY

CONTRACT DATE: ESTABLISHED

ORIGINAL DESCRIPTION: *NONE*

RESTORATION BY, STAMP AND DATE:
Michael C. Springer, PLS
Jason L. Hatfield, PLS

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

JAN 18 2011

BY:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2012

January 14, 2011

EVIDENCE FOUND: None, See record Map of Survey No. 1912.

AT THE CORNER POINT: I set a 5/8"x14" iron pin, with attached 1½" aluminum cap. Pin is driven 10" in the ground to solid bedrock. Built a 3 ft. mound of stone around monument. Cap is marked as shown hereon.

FROM WHICH I SET THE FOLLOWING REFERENCE POINTS:
A 5/8"x30" iron pin bears S.42°28'E., 26.64 ft. with attached 1¼" yellow plastic cap marked "BENCHMARK SURVEYING"
A 5/8"x30" iron pin bears N.83°48'W., 61.94 ft. with attached 1¼" yellow plastic cap marked "BENCHMARK SURVEYING" This is a existing pin that was set during Record Survey No. 1895.

Used RTK GPS to measure to new reference points. Bearings are based on record Map of Survey No. 1912.

BMLS
1
SE 16 · S35
2011
SURVEY MARKER

STATE PLANE COORDINATES: (3601 OR N)
Reference Datum: NAD83(CORS96) from OPUS solution
Northing: 301,447.3 ft.
Easting: 8,671,524.2 ft.
Ellip Ht: 3,864.3 ft.