

CORNER RESTORATION


CORNER: E1/4 SEC. 8 TWP. 13 S. RANGE 28E.

ORIGINAL SURVEY BY: William H. Byars

CONTRACT NUMBER: 197

CONTRACT DATE: July 14, 1873

Subsequently remonumented by Vernon L. Glaze,
County Surveyor, in 1914. See Survey No. 7G.

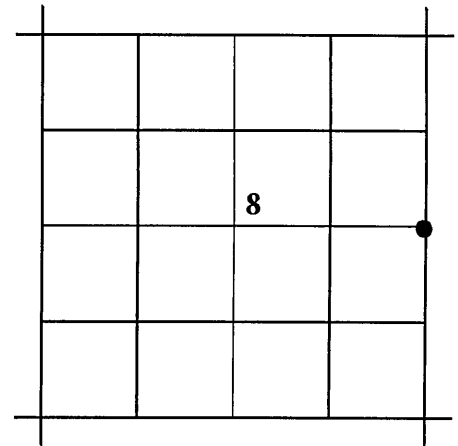

ORIGINAL DESCRIPTION: Set Basalt Stone 14x14x5 for the Quarter Section Corner.

Survey No. 7G states: Common Gov 1/4 cor. sec's 8-9 set iron post with Brass cap marked and wooden post 4x4x4.0 Scribed erected monument of stone.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
S.D. Follweiler
M.C. Springer

RECEIVED AND
FILED

FEB. 24, 2000
OFFICE OF COUNTY SURVEYOR

Robert D. Bagett

ATTEST: *Steven D. Follweiler*

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

Renewal Date 12/31/01

February 4, 2000

Grant County Surveyor

EVIDENCE FOUND: Found Glaze's 1"x36" iron pipe with attached brass cap set 22" in the ground in a mound of stones. The attached 2" brass cap is marked 1/4 in each quadrant, typical of other monuments and markings set by Glaze. Also found the original basalt stone 15"x15"x5" marked 1/4 on west face firmly set 1.5 ft. west of Glaze's brass cap. I accept Glaze's iron pipe and brass cap as the position of the quarter corner.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings including compass var.

At the corner point: I set a 1½"x30" galv. iron pipe, 25" in the ground, with attached Grant County Surveyor brass cap marked as shown.

From which I SET NEW REFERENCE POINTS:

A 5/8"x30" iron pin, bears N45°E, 25.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 1 2000 OPLS 598.

A 5/8"x30" iron pin, bears S45°E, 25.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 2 2000 OPLS 598.

A 5/8"x30" iron pin, bears S45°W, 25.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 3 2000 OPLS 598.

A 5/8"x30" iron pin, bears N45°W, 25.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 4 2000 OPLS 598.

Buried original stone North and alongside new brass cap. I cut Glaze's rusting pipe into 2 pieces and buried these South and alongside the new brass cap.

Repaired the mound of stone, 3 ft. base to top of cap. Used mag. compass with 18° var. and steel tape.

