


CORNER RESTORATION

CORNER W¹/₄ Cor Sec 20 TWP 13 S RANGE 29 E

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

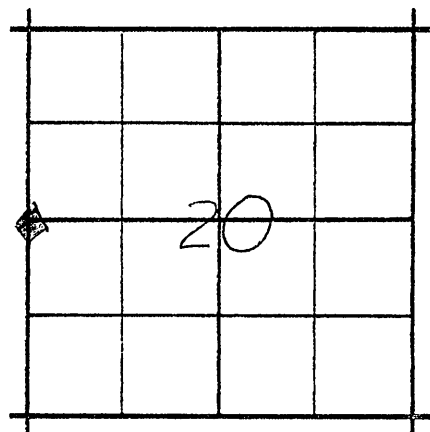

ORIGINAL DESCRIPTION: North bet sec's 19 & 20


40.00 Set Stone 18x8x6 for 1/4 sec Cor.

Vernon Glaze, County Surveyor, reestablished the 1/4 cor in 1914 by setting a stone of unknown size & marking it — 1/4 C.S.

The state Highway Dept. tied Highway 26 to the 1/4 cor, as shown on the 1953 Highway Strip Map.

RESTORATION BY, STAMP AND DATE:

BAGETT & GRIFFITH SURVEYING
170 S. DAYTON - PH. 575-1251
JOHN DAY, OREGON 97845

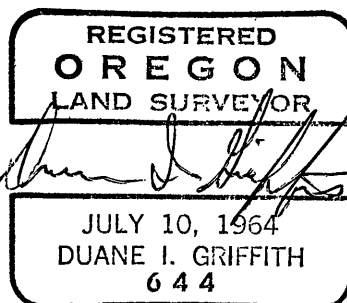

EVIDENCE FOUND: A Basalt Stone 18x10x8 marked 1/4 C.S. set 10" in the ground, and a 2"x30" iron pipe driven 10" below ground surface with a 1"x60" pipe driven inside the 2" pipe set along side the stone.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:


Show how trees are scribed and basis of bearings, including compass var.

I remove the 2" and 1" iron pipe & in its place I set a 2 1/2"x30" iron pipe, with brass cap 24" in the ground. I SURROUND THE pipe with a stone mound. MONUMENT MARKED From which: New BT's

A 14" cottonwood bears S. 52° W., 17 1/2 feet, scribed T13S R29E 1/4 S19 BT

A 16" juniper bears S 55° E 40 1/2 feet, scribed T13S R29E 1/4 S20 BT

Place the corner stone NW & alongside the iron pipe.

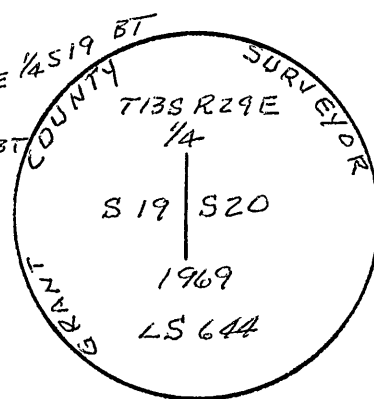

Complete and File with Office of the Grant
County Surveyor, Grant County, Oregon,
Courthouse, Canyon City, Oregon 97820

Compass Bearings
Var. = 20° E