


CORNER RESTORATION

CORNER: E1/4 Cor. Sec. 25, Twp. 13S., R.29E., W.M.

ORIGINAL SURVEY BY: John B. David, U.S. Deputy Surveyor

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1969

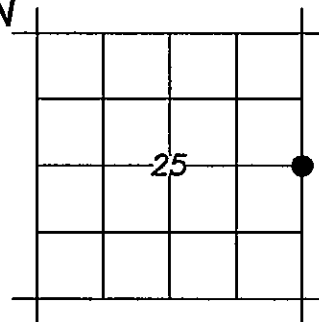

ORIGINAL G.L.O. DESCRIPTION: Set basalt Stone 16x11x4 for 1/4 Sec. Corner


EVIDENCE FOUND: After a diligent search I was unable to find the original GLO stone. I determine that the best available evidence of the original GLO position for this corner to be at the intersection of an existing East-West fence line and the remains of an old down fence running South. Both fences are very old and the East-West fence is relied upon by landowners. The position also fits well with the NE Corner of Section 25 which is a corner position of long standing acceptance.

DESCRIPTION OF MONUMENT AND ACCESSORIES SET:

At the intersection of an East-West fence line and the remains of an old down fence running South, I set a 5/8"x30" iron pin driven 29 inches into the ground, with attached 2" aluminum cap marked as shown below.

FROM WHICH, I set the following reference points:

- A 5/8" x 30" iron pin bears N.51°45'E., 16.39 ft., with attached yellow plastic cap marked BENCHMARK SURVEYING;
- A 5/8" x 30" iron pin bears S.34°57'E., 14.68 ft., with attached yellow plastic cap marked BENCHMARK SURVEYING;
- A 5/8" x 30" iron pin bears S.67°24'W., 17.21 ft., with attached yellow plastic cap marked BENCHMARK SURVEYING;
- A 5/8" x 30" iron pin bears N.40°45'W., 12.90 ft., with attached yellow plastic cap marked BENCHMARK SURVEYING;

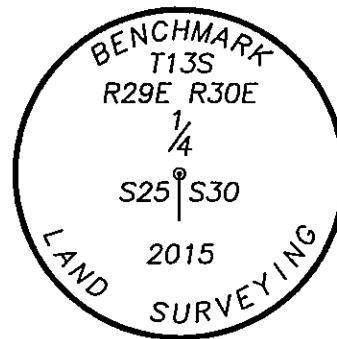

Bearings to reference points are based on Record Map of Survey No. 2022

RESTORATION BY:

Michael C. Springer, PLS
Benchmark Land Surveying, Inc.
217 N. Canyon Blvd.
John Day, OR 97845

March 5, 2015

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

MAR 13 2015

BY: 

