

CORNER RESTORATION

CORNER: N1/4 SEC. 22, TWP. 13 S., RANGE 31 E., W.M.

ORIGINAL SURVEY BY: John B. David


CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

SUBSEQUENT SURVEYS:

- Remonumented by Duane Griffith, County Surveyor, May 19, 1970.
- New corner accessories established by Robert Bagett, County Surveyor in 1995.

See Corner Restoration Records.

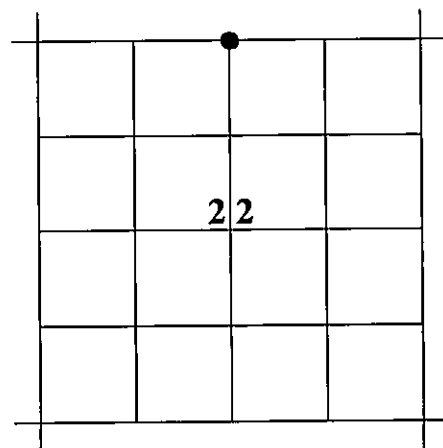

ORIGINAL DESCRIPTION: Set Stone 21"x12"x10".

- Griffith found the original stone in 1970, his record states:
Set 1"x30" iron post with BC mkd.
From which:
A juniper 6" diameter bears S19E, 29.9 ft. mkd. 1/4 S22 BT.
A juniper 8" diameter bears N15E, 58.6 ft. mkd. 1/4 S15 BT.
- Bagett revisited this corner in 1995 and took two new bearing trees. His record states:
A Juniper 9" diam., bears S66°W, 70.2 ft. marked 1/4 S22 CSBT.
A Juniper 8" diam., bears N80°W, 25.8 ft. marked 1/4 S15 CSBT.

RESTORATION BY, STAMP AND DATE:


J.L. Hatfield, PLS

RECEIVED AND
FILED

April 16, 2010

OFFICE OF COUNTY SURVEYOR

ATTEST:

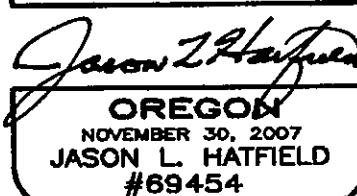

EXPIRES: 6/30/2011


March 1, 2010

Grant County Surveyor (Deputy)

EVIDENCE FOUND AND NEW ACCESSORIES: Found a 1½" iron pipe with attached 2½" brass cap attached, marked as shown below, set in a mound of stone. The monument is in good condition. I found three of the four BT's alive and healthy, with partially healed blazes. The NW bearing tree has been cut, and only a stump remains. The BT tags were no longer attached to the bearing trees.

From the found monument, **I SET A NEW REFERENCE POINT:**

A 5/8" iron pin bears N.43°22'W., 30.04 feet with attached 1½" aluminum cap marked "GRANT COUNTY SURVEYOR RP 1 2010"

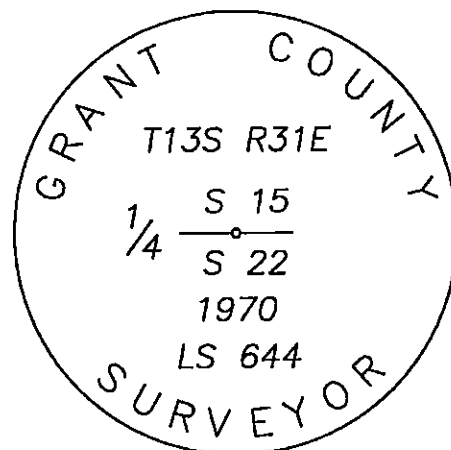

I attached new BT tags to the trees. Bearings are based on geodetic north by GPS observation taken at the corner.

STATE PLANE COORDINATES (3601 OR N) Reference Datum: NAD83

Northing: 282,875.7 ft.

Easting: 8,601,427.7 ft.

Ellip. Ht: 3,203.2 ft.