

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index No. P-5

History of original corner establishment:

This corner was originally established by John B. David in 1869 under GLO Contract 131. The Surveyor General field notes state:

Set Stone 14x9x7 for 1/4 Sec. Corner.

DIAGRAM

T13S R31E  
1/4  
S19 | S20  
1994  
PLS 2632

Description of corner evidence found:

Searched for, not found.

I consider this corner to obliterated. The existant E-W-N fence fits harmoniously with the surrounding corners and I believe the section was broken-down at an early date as witnessed by the split rail fence that ran from near the property corner to the center of the section, as called for in the deed. I accept the fence corner as the best available evidence of the corner.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 1"x30" iron pipe with a 2.375" brass cap stamped as shown on the DIAGRAM, 29" in the ground.

From which:


A 5/8"x30" rebar with plastic cap, bears N82°16'55"E, 30.09 ft.

A 16" double bole juniper, bears N25°22'25"E, 189.85 ft., scribed 1/4 S20 BT

A 5/8"x30" rebar with plastic cap, bears N37°04'14"W, 37.66 ft.

An 8" juniper, bears N89°31'14"W, 220.98 ft., scribed 1/4 S19 BT

Measurements to BT's were taken with an EDM with bearings based on the survey control network. Nailed a stainless steel washer stamped PLS 2632 on blaze as taken this survey.

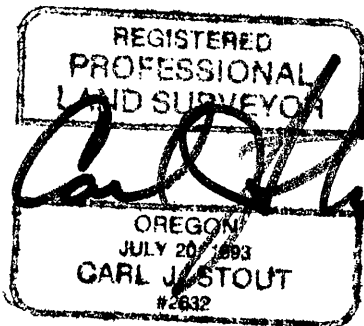

This work was performed by:

Carl J. Stout PLS 2632

Witnessed by: James Hancock and Chad Salvino

May 27, 1994

Refer to Grant Co. Survey No.: 1322

Renewal Date: 12/31/94

Office of Surveyor County of Grant

State of Oregon, I hereby certify that the within instrument was filed in this office for

record on the 22 day of Sept, 19 94

\_\_\_\_\_  
(County Official) by \_\_\_\_\_  
(Deputy)