

CORNER RESTORATION

CORNER: E1/4 SEC. 23 TWP. 13 S. RANGE 31 E., W.M.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869


SUBSEQUENT SURVEYS:

- Remonumented by Robert Bagett, County Surveyor, Jan 27, 1970.
- New corner accessories established by Robert Bagett, County Surveyor in 1995.

See Corner Restoration Records.

ORIGINAL DESCRIPTION: Set stone 17x8x5 for 1/4 sec. cor.

- Bagett found the original stone in 1970, his record states:
I set a 2"x30" iron pipe 24" in the ground, and surrounded same with mound of stone.
I take one new bearing tree.
From the 1/4 cor.
A 12 inch juniper bears S.47°W., 53.5 feet dist., scribed 1/4 S23 BT.
- Bagett revisited this corner in 1995 and took two new bearing trees and set an RP. His record states:
A Juniper 6" diam., bears S66°E, 49.2 ft. marked X CSBT.
A Juniper 8" diam., bears N50°W, 84.1 ft. marked 1/4 S23 CSBT.
A 5/8"x30" iron pin, bears N45°E, 25.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 1 1994 OPLS 598.

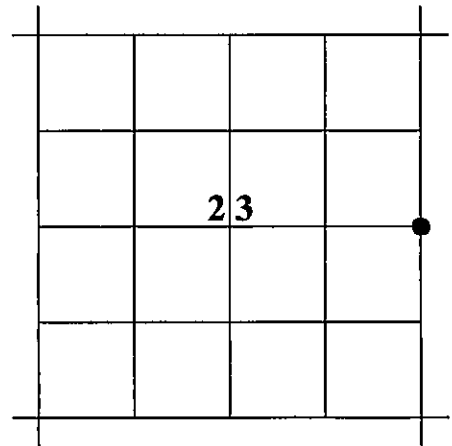

RESTORATION BY, STAMP AND DATE:

J.L. Hatfield, PLS

RECEIVED AND
FILED

March 19, 2010

OFFICE OF COUNTY SURVEYOR

ATTEST:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Jason L. Hatfield


OREGON
NOVEMBER 30, 2007
JASON L. HATFIELD
#69454

EXPIRES: 6/30/2011

March 2, 2010

Grant County Surveyor (Deputy)

EVIDENCE FOUND AND NEW ACCESSORIES: Found a 2" iron pipe with attached 2½" brass cap, marked as shown below, set in a mound of stone. The monument is in good condition. I found all of the BT's alive and healthy, with partially healed blazes. The BT tags were missing from the SW and NE bearing trees. I also found the RP set in 1995.

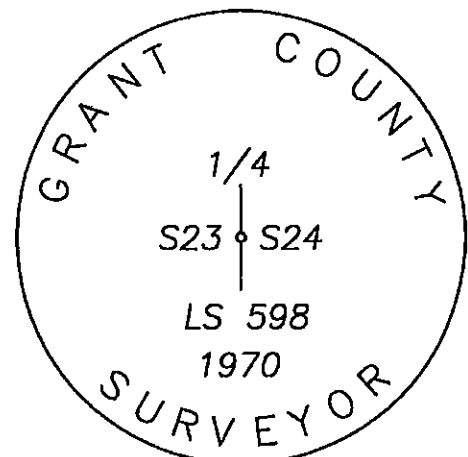

I attached new BT tags to the trees.

STATE PLANE COORDINATES (3601 OR N) Reference Datum: NAD83

Northing: 280,443.15 ft.

Easting: 8,609,456.75 ft.

Ellip. Ht: 3,204.1 ft.