


CORNER RESTORATION

CORNER: SW1/16 SEC. 23 TWP. 13 S. RANGE 31 E.

ORIGINAL SURVEY BY: Elton Saunders, Grant County
Surveyor

DATE: Unknown (prior to 1967)

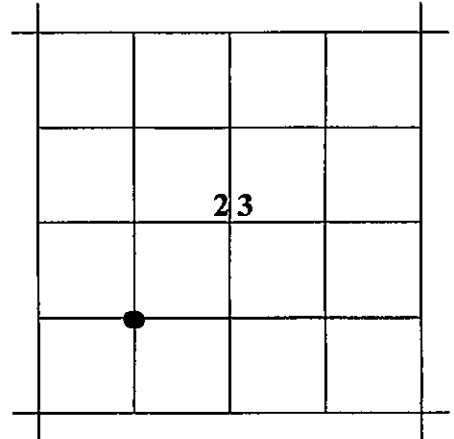

This corner was declared obliterated on Map of Survey No. 111, by Duane Griffith, PLS in 1968. Griffith did not reset a monument at this corner.

The corner was subsequently remonumented by Douglas Ferguson, PLS, Map of Survey No. 446, Filed May 16, 1977.

ORIGINAL DESCRIPTION: Saunders' records shows that he set iron pipe. Ferguson's Map of Survey No. 446 notes that he set a 5/8" iron pin.

RESTORATION BY, STAMP AND DATE:

J.L. Hatfield, PLS
M.C. Springer, PLS


RECEIVED AND
FILED

October 19, 2009

OFFICE OF COUNTY SURVEYOR

[Signature]

ATTEST: *[Signature]*

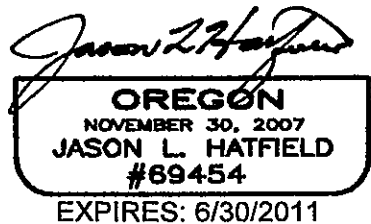

October 14, 2009

EVIDENCE FOUND: I found no remaining evidence of Saunders' iron pipe or Ferguson's iron pin possibly due to past construction activity in the immediate vicinity. However, the position is not lost. I reset this corner at record bearing and distance from the found monument at the C-N-SW1/64 from Record Map of Survey No.'s 111 and 446.

See Record Survey No. 1884

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings including compass var.

At the corner point: I set a 5/8"x30" iron pin, 30" in the ground, with attached 2" diameter aluminum cap marked as shown.

From which I SET NEW REFERENCE POINTS:

A 5/8"x30" iron pin, bears N00°32'10"E, 21.16 ft., with attached yellow plastic cap marked BENCHMARK SURVEYING. See Record Survey No. 1884

A 5/8"x30" iron pin, bears N80°38'33"E, 136.26 ft., with attached yellow plastic cap marked BENCHMARK SURVEYING. See Record Survey No. 1884

Used RTK GPS to measure the RP's.

