

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Original corner established by: John B. David, Deputy Surveyor, under Contract No. 131, dated June 8, 1869.

Surveyor General Record States: Edge of river bank runs south, set stone 15x9x5 inches, for corner to sections 23,24,25 & 26.


BLM Survey by: Harvey Wofford and Lester Fischer, under Survey Group No. 741, dated August 12, 1971.

Record states: At proportionate distance set a 2½" iron post with brass cap, no trees within limits.

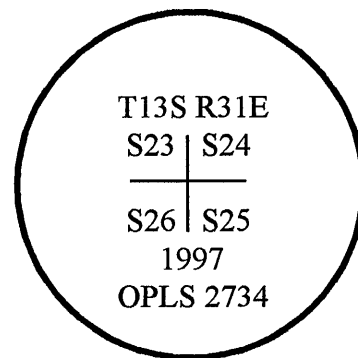

Description of corner evidence found:

None, this corner falls in a pasture. However this corner is not lost. The Oregon State Highway Dept. found a stone at this corner position in 1937, as shown on Hwy Drg. No. 5B-11-10. I have also been informed that the original corner stone was found at this position, but not re-established , by a Professional Land Surveyor prior to its removal.

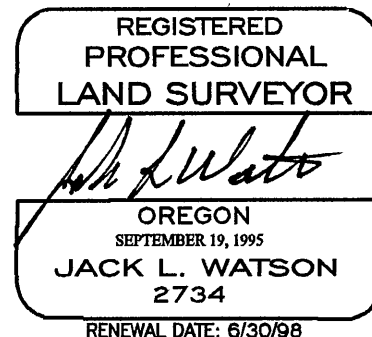

See Land Partition Plat No.97-29

Description of monument and accessories set at corner location:

At the position determined from Hwy Drawing No. 5B-11-10, I set a 2½"x30" aluminum pipe with attached 2½" aluminum cap, 30 inches in the ground, the cap is stamped as shown in the diagram.

From which I set new reference monuments:

- A 5/8"x30" iron pin bears N32°35'E, 95.94 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.
- A 5/8"x30" iron pin bears S46°47'E, 44.68 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.
- A 5/8"x30" iron pin bears S44°40'W, 53.09 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.
- A 5/8"x30" iron pin bears N28°39'W, 93.91 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.

I used a true bearings and EDM distances, to tie references.

Date: September 25, 1997

Office of SURVEYOR County of GRANT
State of OREGON I hereby certify that the within instrument was filed in this office
for record on the 3rd day of NOV, 1997.
Robert D. Sargent by _____
(COUNTY OFFICIAL) (DEPUTY)