

CORNER RESTORATION

CORNER: E1/4 SEC. 25 TWP. 13 S. RANGE 31 E., W.M.


ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

SUBSEQUENT SURVEYS:

- ▶ Remonumented by the Bureau of Land Management in 1971. See Record Map of Survey No. 286.
- ▶ New corner accessories established by Robert Bagett, County Surveyor in 1995. See Corner Restoration Records.

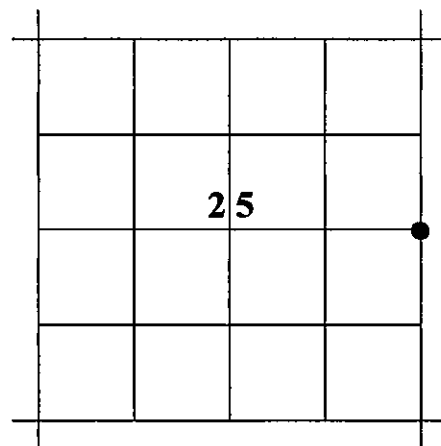

ORIGINAL DESCRIPTION: Set Stone 16X8X7 for 1/4 Sec. corner.

- ▶ The B.L.M. found the original stone in 1971. The B.L.M. record states: Set an iron post, 28 ins. long, 2½ ins. diam., 20 ins. in the ground, with brass cap mkd. (as shown below) from which
A juniper, 13 ins. diam., bears N.29°E., 221 lks. dist., mkd. 1/4 S30 BT.
A juniper, 6 ins. diam., bears S.75¾°W., 23 lks. dist., mkd. 1/4 S25 BT.
- ▶ Bagett found the B.L.M. monument, and both BT's in 1995. His record states (in part):
"Found....A multi-trunk juniper, the east trunk being 16" diam., bears N31°E, 145.8 ft. marked 1/4 S30 BT.
A juniper 12" diam., bears S76°W, 15.2 ft. with partially healed over blaze, scribing visible. Measured to the center of trees."
"....I SCRIBE NEW BEARING TREES:
A Juniper 10" diam., bears S82°E, 61.1 ft. marked 1/4 S30 CSBT.
A Juniper 6" diam., bears N45°W, 67.9 ft. marked X CSBT."

RESTORATION BY, STAMP AND DATE:


M.C. Springer, PLS
J.L. Hatfield, PLS

RECEIVED AND
FILED

December 16, 2009

OFFICE OF COUNTY SURVEYOR

ATTEST:

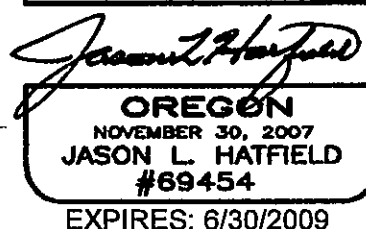


December 16, 2009

Grant County Surveyor (Deputy)

EVIDENCE FOUND: Found a 2½ " galv. iron pipe with attached 3" brass cap, marked as shown below, set in a mound of stone. The monument is in good condition. I found all four BT's alive and healthy, with partially healed blazes. The BT tags were no longer attached to the trees.

I attached new BT tags to the trees.

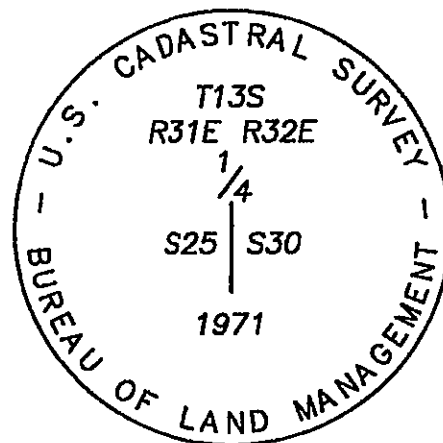

STATE PLANE COORDINATES (3601 OR N)

Reference Datum: NAD83
Northing: 275,268.46 ft.
Easting: 8,614,911.98 ft.
Ellip. Ht: 3,220.1 ft.