

CORNER RESTORATION


CORNER: SW Sec 26 TWP 13S. RANGE 31E.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

Subsequently remonumented by the Bureau of
Land Management Aug-Sept, 1971
See BLM field notes of Record Map of
Survey No. 286

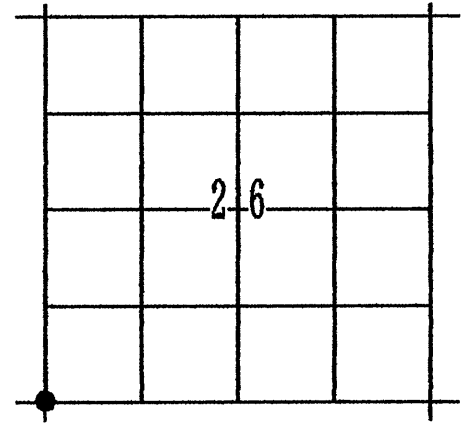

ORIGINAL DESCRIPTION: Set Stone 14x10x8 for corner to Secs. 26, 27, 34, & 35

The BLM found the original stone in 1971. Their record states:

Set an iron post, 28 ins. long, 2½ ins. diam., 18 ins. in the ground, in a mound of stone, 2 ft. base, to top, with brass cap mkd. (marks shown below)



RESTORATION BY, STAMP AND DATE:

R.D. Bagett
G.J. Russell
S.D. Follweiler

RECEIVED AND
FILED

Feb 17, 1995
OFFICE OF COUNTY SURVEYOR

Robert D. Bagett
ATTEST: *Jeremy Russell*

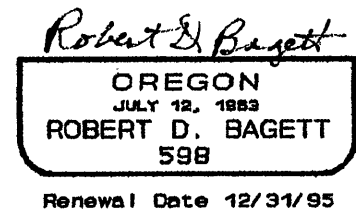

December 29, 1994

Grant County Surveyor

EVIDENCE FOUND: Found a 2½" galvanized iron pipe with attached 3" brass cap marked as shown below, set in a mound of stone.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var..
The monument set in 1971 is in good condition.

From Which:

I SCRIBE A NEW BEARING TREE:

A Juniper 6" diam., bears N81°E, 18.3 ft.
marked X CSBT.

ALSO: I SET NEW REFERENCE POINTS:

A 5/8"x30" iron pin, bears S45°E, 25.00 ft., with
attached alum. cap marked GRANT COUNTY SURVEYOR RP 1
1994 OPLS 598.

A 5/8"x30" iron pin, bears S45°W, 25.00 ft., with
attached alum. cap marked GRANT COUNTY SURVEYOR RP 2
1994 OPLS 598.

A 5/8"x30" iron pin, bears N45°W, 25.00 ft., with
attached alum. cap marked GRANT COUNTY SURVEYOR RP 3
1994 OPLS 598.

MONUMENT MARKED

BUREAU OF LAND
MANAGEMENT

T13S	R31E
S27	S26
S34	S35
1971	
OPLS 598	

Repaired mound of stone 2 ft. base to top of cap. Used mag. compass with 20°E var. and a steel tape, measuring to a 50d nail driven in the sidecenter at the root crown of the BT. Attached BT tags to BT.