

CORNER RESTORATION


CORNER: S1/4 Sec 25 TWP 13S. RANGE 31E.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

Subsequently remonumented by the Bureau of Land Management Aug-Sept 1971.
See BLM field notes of Record Map of Survey No. 286.

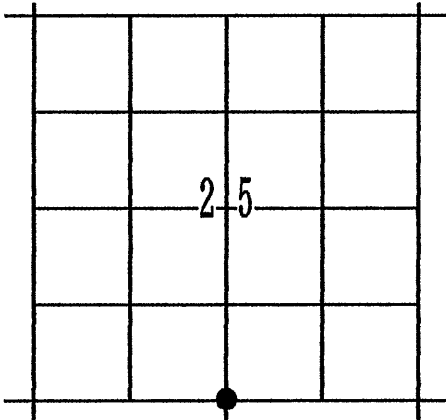

ORIGINAL DESCRIPTION: Set Stone 14x9x6 for 1/4 Sec. corner.

The BLM found the original stone in 1971. Their record states:

Set an iron post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd. (marks shown below)

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
G.J. Russell
S.D. Follweiler

RECEIVED AND
FILED

MAR 2 1995
OFFICE OF COUNTY SURVEYOR

Robert D. Bagett
ATTEST: *Jeremy Russell*

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1983
ROBERT D. BAGETT
598

Renewal Date 12/31/95

February 6, 1995

Grant County Surveyor

EVIDENCE FOUND: Found a 2½" galvanized iron pipe with attached 3" brass cap marked as shown below, set in a mound of stone.

Corner is 30' south of fence running East and West.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

The monument set in 1971 is in good condition.

From which: I SCRIBE NEW BEARING TREES:
A Juniper 6"diam., bears N28°E, 35.0 ft.
marked 1/4 S25 CSBT.
A Juniper 6"diam., bears S86°E, 60.8 ft.
marked X CSBT.
A Juniper 5"diam., bears S43°W, 49.8 ft.
marked X CSBT.
A Juniper 5"diam., bears N55°W, 57.3 ft.
marked X CSBT.

MONUMENT MARKED

BUREAU OF LAND
MANAGEMENT

T13S R31E
S25

1/4 —————
S36
1971

Repaired mound of stone 2 ft. base to top of cap. Used mag. compass with 20°E var. and a steel tape, measuring to a 50d nail driven in the sidecenter at the root crown of the BT's. Attached BT tags to BT's.