

CORNER RESTORATION


CORNER: W1/4 Sec 35 TWP 13S. RANGE 31E.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

Subsequently resurveyed & remonumented by
the Bureau of Land Management Aug-Sept 1971.
See BLM field notes of Record Map of Survey No. 286.

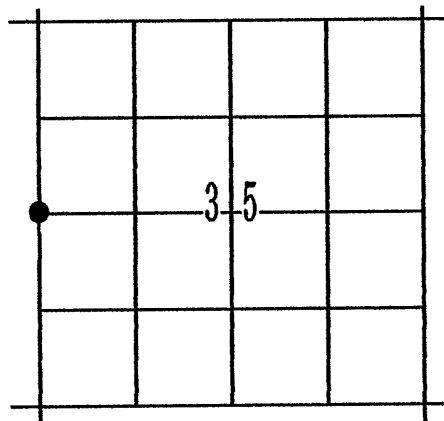

ORIGINAL DESCRIPTION: Set Stone 14x10x8 for 1/4 Sec. Corner.

The BLM did not find the original stone in 1971. Their record states:
40.02 Point for the $\frac{1}{4}$ sec. cor. of secs. 34 and 35, at proportionate
distance; there is no remaining evidence of the original corner.

Set an iron post; 28 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with
brass cap mkd. (marks shown below).

from which

A juniper, 8 ins. diam., bears N.38 $\frac{1}{2}$ °E., 228 lks. dist., mkd. $\frac{1}{4}$ S35 BT.
A juniper, 14 ins. diam., bears S.18°W., 218 lks. dist., mkd. $\frac{1}{4}$ S34 BT.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
J.L. Watson
G.J. Russell
S.D. Follweiler

RECEIVED AND
FILED

MAR 2, 1995
OFFICE OF COUNTY SURVEYOR

ATTEST:

Robert D. Bagett
Jeremy Russell

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1983
ROBERT D. BAGETT
598

Renewal Date 12/31/95

February 3, 1995

Grant County Surveyor

EVIDENCE FOUND: Found a $2\frac{1}{2}$ " galvanized iron pipe with attached 3" brass
cap marked as shown below, set in a mound of stone.

From which:

A Juniper 15"diam., bears N39°E, 150.5 ft. with partially healed over
blaze, scibing visible.

A Juniper 14"diam., bears S20°W, 143.9 ft. with partially healed over
blaze, scibing visible.

Measured to the center of trees.

Corner is 15' east of a fence running North and South.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

The monument set in 1971 is in good condition.

From which: I SCRIBE NEW BEARING TREES:
A Juniper 8"diam., bears S40°E, 104.5 ft.
marked 1/4 S35 CSBT.
A Juniper 6"diam., bears N49°W, 39.0 ft.
marked X CSBT.

MONUMENT MARKED
BUREAU OF LAND
MANAGEMENT

T13S R31E

$\frac{1}{4}$
S34 | S35
1971

Repaired mound of stone 3 ft. base to top of cap. Used mag. compass with
20°E var. and a steel tape, measuring to a 50d nail driven in the
sidecenter at the root crown of the BT's. Attached BT tags to BT's.

X-17