

CORNER RESTORATION


CORNER: $W\frac{1}{4}$ Sec 25 TWP 13S. RANGE 32E.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

Subsequently remonumented by Robert D. Bagett, County Surveyor, Mar. 11, 1978, See corner restoration records.

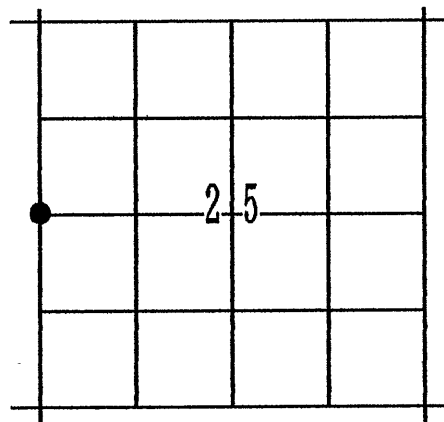

ORIGINAL DESCRIPTION: set stone 16x11x9 for $\frac{1}{4}$ Sec. corner.

I found the original stone in 1978, my record states:

At the corner point: Set $1\frac{1}{2}$ "x30" iron pipe 26" in the ground with brass cap marked as shown. (marks shown below).
from which:

A 6" juniper bears N.86°E, 75.2 feet, marked $\frac{1}{4}$ S25 CSBT.

A 13" juniper bears N.34°W, 219.6 feet, marked $\frac{1}{4}$ S26 CSBT.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
G.J. Russell
S.D. Follweiler

RECEIVED AND
FILED

APRIL 20, 1995
OFFICE OF COUNTY SURVEYOR

Robert D. Bagett
ATTEST: Steven D. Follweiler

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1983
ROBERT D. BAGETT
598

Renewal Date 12/31/95

March 6, 1995

Grant County Surveyor

EVIDENCE FOUND: Found a $1\frac{1}{2}$ " iron pipe with a $2\frac{1}{2}$ " Grant County Surveyor brass cap marked as shown below, set in a mound of stone.

A Juniper 24"diam., bears N34°W, 219.2 ft., with healed over blaze.
(measured to face of blaze.)

No evidence of record Juniper BT in Section 25.

Corner is at corner of fences running North South and West.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

The monument set in 1978 is in good condition.

MONUMENT MARKED

From which: I SET NEW REFERENCE POINTS:

A $\frac{5}{8}$ "x30" iron pin, bears N45°E, 25.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 1 1995 OPLS 598.

A $\frac{5}{8}$ "x30" iron pin, bears S45°E, 25.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 2 1995 OPLS 598.

A $\frac{5}{8}$ "x30" iron pin, bears S45°W, 25.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 3 1995 OPLS 598.

GRANT COUNTY
SURVEYOR
T13S R32E
 $\frac{1}{4}$
S26 | S25
1978
OPLS 598

Repaired mound of stone 2 ft. base to top of cap. Used mag. compass with 20°E var. and a steel tape.