

CORNER RESTORATION

CORNER: W1/4 SEC. 31 TWP. 13 S. RANGE 32 E., W.M.


ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

SUBSEQUENT SURVEYS:

- ▶ Remonumented by the Bureau of Land Management in 1971. See Record Map of Survey No. 286.
- ▶ New corner accessories established by Robert Bagett, County Surveyor in 1995. See Corner Restoration Records.

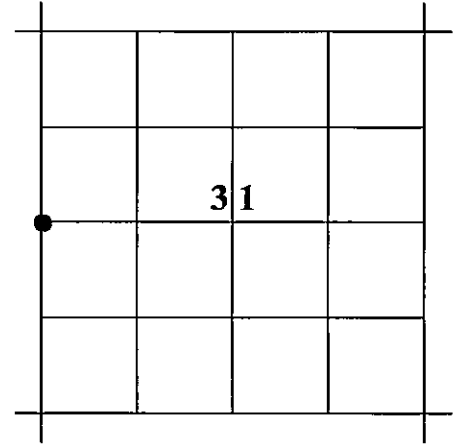

ORIGINAL DESCRIPTION: Set Stone 16X12X6 for 1/4 Sec. corner.

- ▶ The B.L.M. found the original stone in 1971. The B.L.M. record states: Set an iron post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd. (as shown below)
- ▶ Bagett found the B.L.M. monument, and established new accessories. His record states:
“...I SET NEW REFERENCE POINTS:
A 5/8"x30" iron pin, bears N27°E, 25.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 1 1995 OPLS 598.
A 5/8"x30" iron pin, bears S20°E, 20.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 2 1995 OPLS 598.
A 5/8"x30" iron pin, bears S27°W, 20.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 3 1995 OPLS 598.
A 5/8"x30" iron pin, bears N20°W, 20.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 4 1995 OPLS 598.”

RESTORATION BY, STAMP AND DATE:

M.C. Springer, PLS
J.L. Hatfield, PLS

RECEIVED AND
FILED

December 18, 2009
OFFICE OF COUNTY SURVEYOR
[Signature]
ATTEST: *[Signature]*



December 17, 2009

Grant County Surveyor (Deputy)

EVIDENCE FOUND: Found a 2½ " galv. iron pipe with attached 3" brass cap, marked as shown below, set in a mound of stone. The monument is in good condition. We also found all four RP's. The NE pin (RP 1) was missing a cap.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

We attached a 1½" aluminum cap marked "Grant County Surveyor RP 1 2009" to the NE RP.

STATE PLANE COORDINATES (3601 OR N)

Reference Datum: NAD83
Northing: 269,971.04 ft.
Easting: 8,615,028.43 ft.
Ellip. Ht: 3,594.3 ft.

