


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner established in 1881
by Robb & Graden:
Set basalt stone 16x12x6 in mound
of stone.
Retracement in 1901 by G. Campbell:
Found basalt stone 16x12x6, unstable,
reestablished at same point from which
A 15" Pine brs. N 57° W 31 lks (20.5')

Corner # 2-7

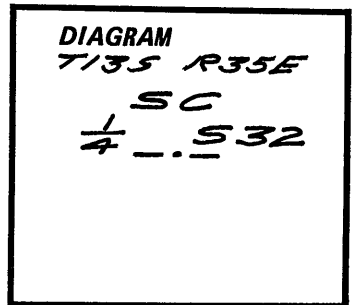

Description of corner evidence found:

Search area falls on steep unstable hillside. No
evidence of original corner or bearing tree remains.
Established corner position by single proportion
between Standard Corner Sections 31-32 and
Standard Corner Sections 32-33.

Description of monument and accessories | established to perpetuate the
original location of this corner:

Set 2 1/2" x 30" aluminum pipe with 3" aluminum cap
rising 9" in stone mound.

New BTs:

A 11" Fir brs. N 74° W 15.9'
marked 1/4 532 SC BT.
A 5" Ponderosa Pine brs. N 24° E 10.4'
marked 1/4 532 SC BT.

Cap marked
SC

T135 R35E

$\frac{1}{4}$ 532

--

1986

LS1020

I hereby certify the above corner point was
established as described in June, 1986, U.S.F.S.
bearing tree signs were placed on all BTs and
a 6" red band was painted around each BT.

Office of... SURVEYOR ... County of... CLATSOP ...
State of... OREGON ... I hereby certify that the within instrument was filed in this office
for record on the... 3 ... day of... Sept ... 19... 86
... Robert D. Beyer ... by ...
(COUNTY OFFICIAL) (DEPUTY)

