CORNER RESTORATION

CORNER: C-N1/16 COR. SEC. 24, TWP. 13 S., RANGE 26 E., W.M.

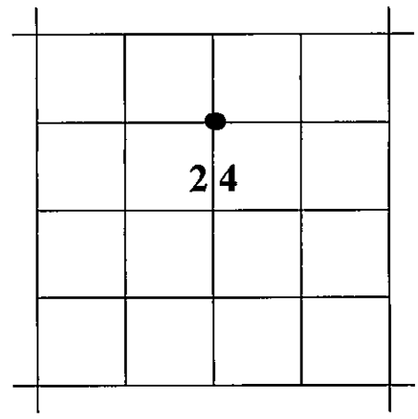

ORIGINAL SURVEY BY: NOT

CONTRACT NUMBER: PREVIOUSLY

CONTRACT DATE: ESTABLISHED

ORIGINAL DESCRIPTION: None

RESTORATION BY, STAMP AND DATE:
Michael C. Springer, PLS

RECEIVED AND FILED

JUNE 30, 2010

OFFICE OF COUNTY SURVEYOR

ATTEST:

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2012

June 24, 2010 **SEE RECORD SURVEY NO. 1893**

EVIDENCE FOUND: Corner not previously established

AT THE CORNER POINT: Set a 5/8"x30" iron pin with attached 2" aluminum cap 28" in the ground. Built a 1 foot mound of stone. Cap is marked as shown below. Corner falls in a cut bank on the West side of South Fork County Road No. 42.

FROM WHICH I SET THE FOLLOWING REFERENCE POINTS:
A 5/8"x30" iron pin bears N.51°02'E., 68.36 feet. with attached 1½" aluminum cap marked "BMLS SURVEY MARKER RP1 2010"
A 5/8"x30" iron pin bears S.50°39'E., 92.48 feet. with attached 1½" aluminum cap marked "BMLS SURVEY MARKER RP2 2010"

Used RTK GPS to measure to the reference points.

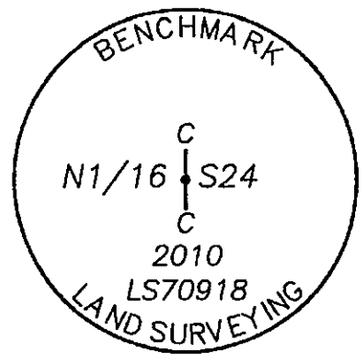

STATE PLANE COORDINATES: (3601 OR N)
Reference Datum: NAD83
Northing: 279,497.9 ft.
Easting: 8,452,473.0 ft.
Ellip Ht: 2,445.8 ft.