CORNER RESTORATION

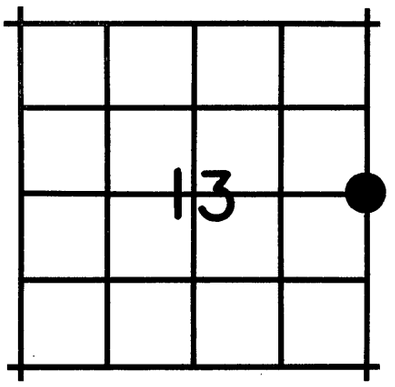

E¼ Cor.
CORNER Sec. 13 **TWP** 13 S. **RANGE** 33 E.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

ORIGINAL DESCRIPTION:
Set Stone 16x10x9 inches for 1/4 Section Corner.

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
J. L. Watson

November 18, 1988

RECEIVED AND FILED
DEC 2 1 1988
OFFICE OF COUNTY SURVEYOR
Attest:

REGISTERED PROFESSIONAL LAND SURVEYOR
Robert D. Bagett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598
Grant County Surveyor

EVIDENCE FOUND:
Found a 5/8" O.D Iron Pipe driven flush with the ground. This is the same kind of iron pipes we found around Section 12, T. 13 S., R. 33 E. I also found the original cornerstone 16x7x6 inches, marked 1/4 lying loose on ground N. 13° 26' E., 13.8 feet from this pipe. This iron pipe is harmoniously related to other known corners in the area. I accept the position of the iron pipe for this 1/4 section corner.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

MONUMENT MARKED

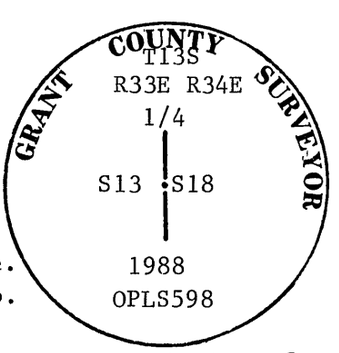

At the Corner Point: Set a 1½"x30" Galvanized iron pipe 31 inches in the ground, with attached Brass Cap marked as shown:
From which I set New Reference Points:
A 5/8"x30" iron pin with attached 1½" Alum Cap marked, Grant County Surveyor RP1 1988, bears N. 45° E., 50.45 feet, set in North-South fenceline.
A 5/8"x30" iron pin with attached 1½" Alum Cap marked, Grant County Surveyor RP2 1988, bears West, 25.00 feet, set in a East-West fenceline.
Buried marked cornerstone Southeast and alongside the iron pipe.
Surrounded pipe with a mound of stone 2 foot base to top of cap.
Placed found 5/8" pipe inside my iron pipe.
Used magnetic compass with 20° E., variation and steel tape for measurements to reference points.
No bearing trees or bearing objects available.
This corner is 3 feet East of fence corner of fences running North, South and West.

L-25