


CORNER RESTORATION

CORNER NW cor.
Sec 12 TWP 14 S RANGE 30 E
ORIGINAL SURVEY BY: S.W. Lackland
CONTRACT NUMBER: 357
CONTRACT DATE: July 2, 1880

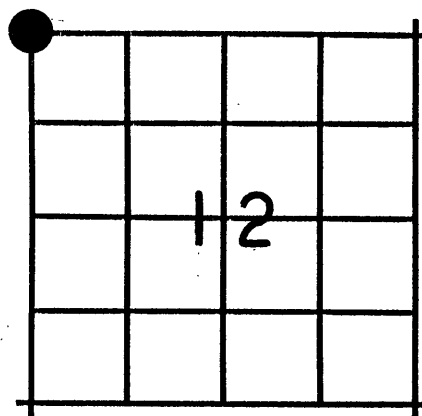

ORIGINAL DESCRIPTION: Set stone 20x12x12 in mound of stone for corner to Sections 1, 2, 11 & 12.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
J.L. Watson
K.J. Workman

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

RECEIVED AND
FILED

APR 25 1989

OFFICE OF COUNTY SURVEYOR
Robert D. Bagett
Attest:

March 13, 1989

EVIDENCE FOUND:

This corner is lost due to road construction. I set the corner at double proportionate measure between the NW corner of Section 1 and the SW corner of Section 12, and the found S 1/4 corner of Section 2 and the found S 1/4 corner of Section 1. The centerline stripe of County Road No. 49 is 1 foot west.

SEE RECORD MAP OF SURVEY NO. 1071

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: I set a 5/8"x30" iron pin, with attached 1-1/2" alum. cap, driven flush with the paved surface of County Road No. 49. Cap marked as shown.

No corner accessories were taken.

MONUMENT MARKED

