


CORNER RESTORATION

CORNER: W1/4 CORNER SEC. 17 TWP. 14 S. RANGE 31 E., W.M.

ORIGINAL SURVEY BY: Bamford Robb, Deputy U.S. Surveyor

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

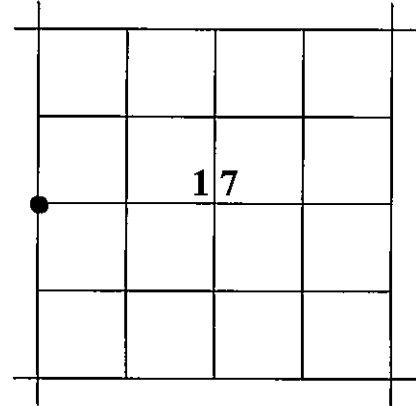

ORIGINAL DESCRIPTION: Set Stone 10X8X5 in mound of stone for 1/4 Sec. cor.

RESTORATION BY, STAMP AND DATE:

J.L. Hatfield, PLS

RECEIVED AND FILED
GRANT COUNTY SURVEYOR


JUN 01 2012

BY: 



Benchmark Land Surveying
217 N. Canyon Blvd.
John Day, OR 97845

May 21, 2012

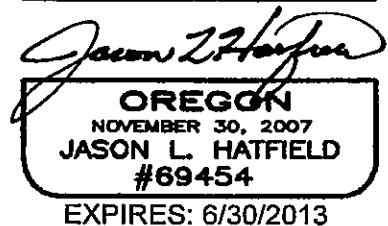

See Record Map of Survey No. 1949

EVIDENCE FOUND: After a diligent search, we found no remaining evidence of the original corner. I determine this corner lost, and re-establish its position by proportionate measurement between the monuments at the NW corner Section 17 and the SW Corner Section 17.

DESCRIPTION OF MONUMENT AND ACCESSORIES:


At the corner point, I set a 5/8"x14" iron pin with attached 2" aluminum cap 13" in the ground. Raised a small mound of stone to top of cap. Aluminum cap is marked as shown below.

From which, I SET REFERENCE POINTS:

- ▶ A 5/8"x30" iron pin bears N.38°34'E., 24.90 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING".
- ▶ A 5/8"x30" iron pin bears S.67°21'E., 13.71 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING".
- ▶ A 5/8"x16" iron pin bears S.44°16'W., 20.11 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING".

I ALSO SCRIBE A BEARING TREE:

- ▶ A juniper, 23" DBH, bears N.67°31'W., 24.4 ft., marked 1/4 S18 BT.

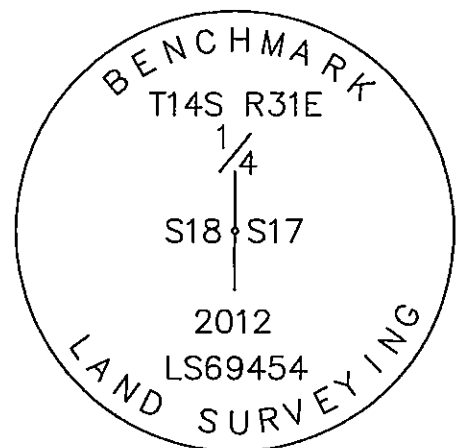

Used RTK GPS to measure RP's. Used a steel tape to measure distance to the bearing tree, measuring to a 50d nail driven in the side-center at the root crown of the tree. Attached BT tag to the tree. Bearings are based on Map of Survey No. 1949.