


# CORNER RESTORATION

**CORNER:** E1/4 CORNER SEC. 17 TWP. 14 S. RANGE 31 E., W.M.

**ORIGINAL SURVEY BY:** Bamford Robb, Deputy U.S. Surveyor

**CONTRACT NUMBER:** 357

**CONTRACT DATE:** July 2, 1880

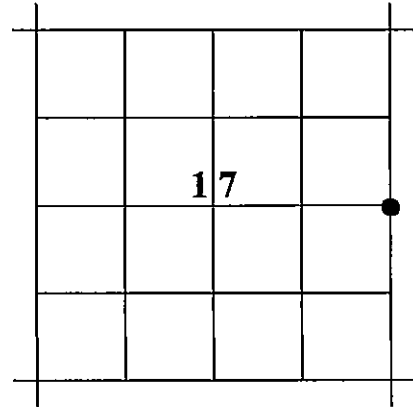

**ORIGINAL DESCRIPTION:** Set Stone 14X10X8 in mound of stone for 1/4 Sec. cor.

## RESTORATION BY, STAMP AND DATE:

J.L. Hatfield, PLS



Benchmark Land Surveying  
217 N. Canyon Blvd.  
John Day, OR 97845

May 21, 2012

RECEIVED AND FILED  
GRANT COUNTY SURVEYOR

JUN 01 2012

BY: 

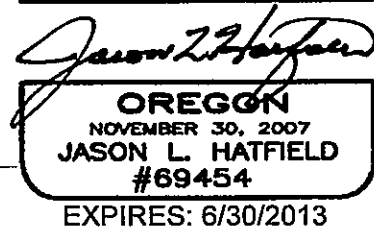

See Record Map of Survey No. 1949

**EVIDENCE FOUND:** After a diligent search, I found no remaining evidence of the original corner. I determine this corner lost, and re-establish its position by proportionate measurement between the established monument at the NE corner Section 17, and the found B.L.M. monument at the SE Corner Section 17.

## DESCRIPTION OF MONUMENT AND ACCESSORIES:

At the corner point, I set a 5/8"x30" iron pin with attached 2" aluminum cap 29" in the ground. Raised a 3 foot diameter mound of stone to top of cap. Aluminum cap is marked as shown below.

From which, I SET REFERENCE POINTS:

- ▶ A 5/8"x30" iron pin bears N.45°17'E., 15.06 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING".
- ▶ A 5/8"x30" iron pin bears S.45°49'E., 16.00 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING".
- ▶ A 5/8"x30" iron pin bears S.45°25'W., 16.08 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING".
- ▶ A 5/8"x30" iron pin bears N.45°52'W., 15.18 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING".

