


CORNER RESTORATION

CORNER: S1/4 CORNER SEC. 17 TWP. 14 S. RANGE 31 E., W.M.

ORIGINAL SURVEY BY: Bamford Robb, Deputy U.S. Surveyor

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

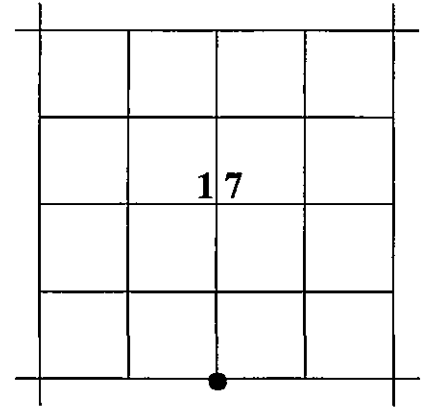


ORIGINAL DESCRIPTION: Set Stone 14X12X7 in mound of stone for 1/4 Sec. cor.

RESTORATION BY, STAMP AND DATE:

J.L. Hatfield, PLS

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

JUN 0 1 2012

BY: 



Benchmark Land Surveying
217 N. Canyon Blvd.
John Day, OR 97845

May 16, 2012

See Record Map of Survey No. 1949

EVIDENCE FOUND: After a diligent search, we found no remaining evidence of the original corner. I determine this corner lost and re-establish its position by proportionate measurement between the found monument at the SE Corner Section 17 and the established monument at the SW Corner Section 17.

DESCRIPTION OF MONUMENT AND ACCESSORIES:

At the corner point, I set a 1½" x30" galvanized iron pipe with attached 2½" brass cap 28" in the ground. Raised a 3 foot diameter mound of stone to top of cap. Brass cap is marked as shown below.

From which, I SET REFERENCE POINTS:

- ▶ A 5/8"x30" iron pin bears S.45°01'E., 25.65 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING".
- ▶ A 5/8"x30" iron pin bears S.45°02'W., 25.61 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING".
- ▶ A 5/8"x30" iron pin bears N.44°55'W., 25.62 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING".

I ALSO SCRIBE A BEARING TREE:

- ▶ A juniper, 10" DBH, bears N.24°05'E., 46.1 ft., marked 1/4 S17 BT.



Used RTK GPS to measure RP's. Used a steel tape to measure the distance to the bearing tree, measuring to a 50d nail driven in the side-center at the root crown of the tree. Attached a BT tag to the tree. Bearings are based on Map of Survey No. 1949.