


CORNER RESTORATION

North $\frac{1}{4}$ cor.
CORNER Sec. 35 TWP 14 S. RANGE 31 E., W.M.

ORIGINAL SURVEY BY: Bamford Robb

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

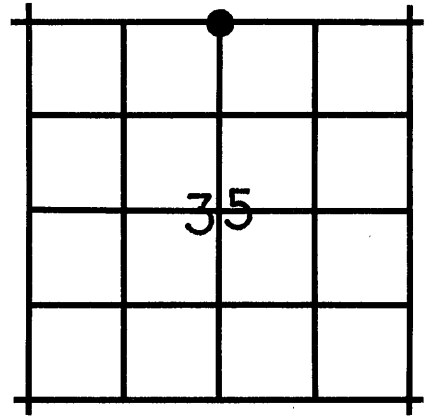

ORIGINAL DESCRIPTION:

N. $89^{\circ} 50'$ W. on true line between Secs. 26 & 35.


40.06 set post for $\frac{1}{4}$ Sec. cor., from which,

A pine 10" in diam. bears S. 40° W. 90 lks. dist.


A pine 14" in diam. bears N. 80° E. 20 lks. dist.

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
S. L. Crane



Robert D. Bagett



October 18, 1977

RECEIVED AND
FILED

NOV 25 1977
John Liveira
JOHN LIVEIRA, County Clerk

By _____ Deputy
Grant County Surveyor

EVIDENCE FOUND:

No evidence of original $\frac{1}{4}$ corner was found.

After a diligent search for corner evidence, with no luck, I set the corner at single proportionate distance between the found section corners at the N.W. and N.E. corners of the section.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point, I set a $1\frac{1}{2}$ "x30" iron pipe 23" in the ground in a mound of stone with brass cap marked as shown. From which I tag and scribe new B.T.'s.

A fir 18" in diam. bears N. 35° E. 11.4 feet, marked $\frac{1}{4}$ S26 CSBT.

A fir 12" in diam. bears S. 26° E. 19.8 feet, marked $\frac{1}{4}$ S35 CSBT.

Corner is 2 feet North of East-West fence and about 250 feet West of North-South fence.

I used a compass with a 20° East variation and steel tape, measuring to face of blaze on B.T.'s.

See Map of Survey No. 467.

MONUMENT MARKED

