

# RECORD OF LAND CORNER MONUMENTATION


CORNER: SE Cor. Sec. 36, Twp. 14S., R.31E., W.M.

ORIGINAL SURVEY BY: Banford Robb

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

SUBSEQUENT SURVEY: Geo. F. Rigby 1939

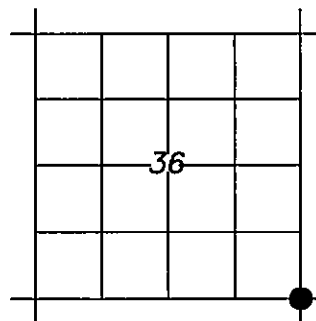

**ORIGINAL G.L.O. DESCRIPTION:** Set post for cor. to Townships 14 & 15 S. Ranges 31 & 32 East—from which: A pine 24 in. diam. bears S.70°W., 33 lks. dist. A pine 32 in. diam. bears S.55°E., 80 lks. dist. A pine 30 in. diam. bears N.50°E., 105 lks. dist. A pine 36 in. diam. bears N.55°W., 211 lks. dist.

**1910 GLO RESURVEY WILLIAM N. GIBB, UNITED STATES DEPUTY SURVEYOR, UNDER HIS CONTRACT NO. 783, DATED 12/3/1908:** At the cor. of Ts. 14 & 15 S., Rs. 31 & 32 E., lat. 44°18'N., long. 119°00'W., which is a stake greatly decayed, marked and witnessed as described by the Surveyor General, set granite stone, 6x8x15 ins. 10 ins. in the ground for Tp. cor. Ts. 14 & 15 S., Rs. 31 & 32 E., marked with 6 notches on each edge.

**1938 GLO RESURVEY BY GEO. F. RIGBY, CADASTRAL ENGINEER UNDER SPECIAL INSTRUCTIONS DATED 3/19/1938 INCLUDED IN GROUP NUMBER 216:** The original cor. or Tps. 14 and 15 S., Rs. 31 and 32 E., which is a basalt stone, 14x12x8 ins., loosely set, mkd. with 6 grooves on each side. At point for cor. Set an iron post, 3 ft. long, 3 ins. diam., 28 ins. in the ground, with the original stone deposited at the base, for cor. of Tps. 14 and 15 S., Rs. 31 and 32 E., with brass cap mkd. as shown. From which: A pine, 28 in. diam. bears N.52°30'E., 101 lks. dist. mkd. T14S R32E S31 BT. (Old BT) A pine, 34 in. diam. bears S.56°30'E., 84 lks. dist. mkd. T15S R32E S6 BT. (OLD BT) A pine, 32 in. diam. bears S.68°30'W., 33 lks. dist. mkd. T15S R31E S1 BT. (Old BT) A dead pine, 45 in. diam. bears N.54°30'W., 209 lks. dist. mkd. T14S R31E S36 BT. (Old BT) A pine, 14 in. diam. bears N.31°30'W., 93 lks. dist. mkd. T14S R31E S36 BT. (New BT).

**EVIDENCE FOUND:** Found 3" iron pipe with 3-1/2" GLO brass cap protruding 8"-10" in the air. All BT's, with partially healed blazes, scorched and killed during 2015 Canyon Creek fire. Cor. is 10 ft. Easterly of fence running NE-SW.

## DESCRIPTION OF MONUMENT AND ACCESSORIES SET:

Set fiberglass survey marker post next to mound of stone. Built mound of stone 3' around the Sec. cor.

## FROM WHICH, I set the following reference points:


- A 5/8" x 30" iron pin, bears N.53°45'E., 6.27 ft., with attached Grant County Surveyor Alum. Cap mkd. RP1 2015.
- A 5/8" x 30" iron pin, bears S.56°39'E., 9.94 ft., with attached Grant County Surveyor Alum. Cap mkd. RP2 2015.
- A 5/8" x 30" iron pin, bears S.23°17'W., 11.31 ft., with attached Grant County Surveyor Alum. Cap mkd. RP3 2015.
- A 5/8" x 30" iron pin, bears N.68°24'W., 8.56 ft., with attached Grant County Surveyor Alum. Cap mkd. RP4 2015.

Used RTK GPS to measure RP1-RP4. Bearings to RP's are based on Geodetic North from a GPS observation taken at the corner point.

## STATE PLANE COORDINATES (3601 ORN)

Reference Datum: NAD83(2011) from an OPUS Solution

Northing: 236,790.6 ft.  
Easting: 8,612,573.9 ft.  
Ellip. Ht: 4,566.9 ft.

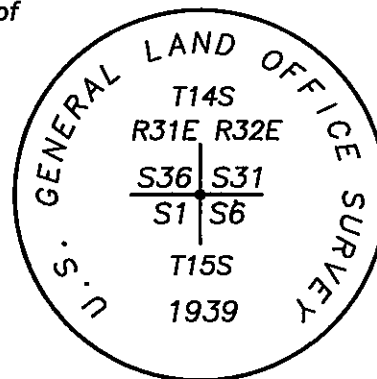

## RESTORATION BY:

Michael C. Springer, PLS  
Grant County Surveyor  
Marcus Teague, Technician  
217 N. Canyon Blvd.  
John Day, OR, 97845

Surveyed October 14, 2015

RECEIVED AND FILED  
GRANT COUNTY SURVEYOR

OCT 16 2015

BY:



EXPIRES: 6/30/2016