


# **CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

INDEX No. E-11

**History of original corner establishment:**

Corner was originally established by G.R. Campbell in June, 1901, under General Land Office Contract No. 724. U.S. Surveyor Generals Notes State: Set a basalt stone 20x12x6 in. in the ground for 1/4 Sec. cor, marked 1/4 on N face: from which: (See original notes, trees are lost) In 1953, before the road construction, the U.S.F.S found the original Bearing Trees, established the corner position and referenced the corner to two trees. In 1957, H.E. Taylors notes state: The original stone and both BT's are gone as this falls in "Y" of newly constructed USFS roads. USFS marked two reference trees before construction. I reset corner by intersecting their dist. from their trees. Drove 5/8" reinforcing iron in stone mound and scribe two new BT's as follows: 24" Tam. snag S83°E., 152.6 ft) Orig. USFS 36" Tam. S62°W., 146.6 ft. ) reference trees 26" Pine N80°W. 118.9 ft. "1/4 S" BT. Put alum tag. painted red on NW BT.

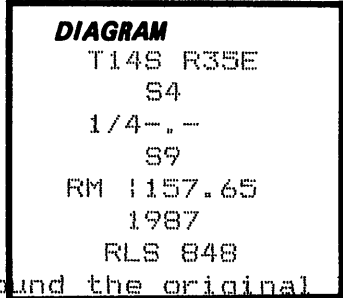


**Description of corner evidence found:**

No trace of the original stone is found, the stone is lost to road construction. Found a 5/8" iron pin as called for in H.E. Taylors remonumentation notes of 1957. The original Bearing Trees are lost to road construction. Found the two reference trees as set by the U.S.F.S. as references to the corner and called for by Taylor, A Tamarack 40" dia., with scribing visible and a 24" Tamarack stump with scribe visible. Also found the Tree as taken by Taylor, a Pine stump 26" dia., with scribing visible. All the trees conform to the measurements as recorded in Taylors 1957 notes. Accepted the said iron pin as the 1/4 Sec. Cor.

**Description of monument and accessories I established to perpetuate the original location of this corner:**

Did not remove the 5/8" iron pin as set by H.E. Taylor, in 1957. Set 2-1/2"x30" aluminum pipe with 3-1/2" aluminum cap, stamped as shown on the **DIAGRAM**, SET 28" in the ground, for Reference Monument, S 0°08'04"E., 157.65 ft. from the iron pin. Scribed New Bearing Trees, Referencing the iron pin at the section corner: A Fir 10" dia., Bears N 80°46'E., 195.2 ft., scribed: 1/4 S4 BT A Fir 10" dia., Bears S 0°31'E., 169.5 ft., scribed: 1/4 S9 BT Measurements to accessories with an electronic tacheometer with angles turned from the survey control network. Nailed a brass washer stamped RLS 848 on blaze above BT scribe, Bearing Tree Sign above blaze, and warning sign on back of each tree. Painted a 6" red band at breast ht. around each tree. Set steel fence post with warning & Boundary Signs, North 4 ft. from the Reference Monument.

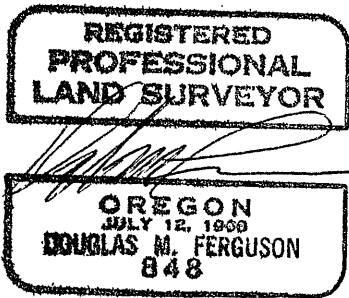

This work is performed by:  
Douglas M. Ferguson RLS 848  
Mt. Vernon Oregon.  
On: July 9, 1987  
Refer to Map of Survey No. 1009

Office of Surveyor County of Grant  
State of Oregon , I hereby certify that the within instrument was filed in this office  
for record on the 6 day of Nov , 1987  
Robert D. Baggett by \_\_\_\_\_  
(COUNTY OFFICIAL) (DEPUTY)