

History of original corner establishment:

Corner was established by Deputies Banford Robb and Samuel W. Lackland in 1880, contract #357.
Set: Stone 14"x12"x6". Marked: 30" Pine S30W--57 lks;
30" Pine N65W--91 lks..

Corner was monumented by OPLS 598 in 1977 from original evidence. See recorded.

DIAGRAM

T14S R31E
1/4 $\frac{S35}{S2}$
T15S

Description of corner evidence found:

1" gal. iron pipe with a 2½" brass cap firmly set 12" above ground in a small mound of stone in E/W fence. Stamped:

T14S R31E
1/4 $\frac{S35}{S2}$
T15S
1977
OPLS 598

Orig. 30" now 36" sawed, rotted Ponderosa Pine stump N65W--61.1'(60.1' to blaze) No marks remain.

1977 14" now 17" Ponderosa Pine N2E--29.4' Scribing visible on double blaze.
1977 14" now 14" D-Fir S80E--14.8'(record S85W) Healed double blaze.

Guard posts West and South with 54-2 and 54-9 signs.


Description of monument and accessories | established to perpetuate the original location of this corner:

Marked:


10" D-Fir S39 3/4W--20.0' Scribed 1/4 S2 BT with a 1" brass disk stamped PLS 896 nailed flush between the B and the T.
16" D-Fir N40E--17.9' Scribed 1/4 S35 BT with a 1" brass disk stamped PLS 896 nailed flush between the B and the T.

Painted bands and blazes on all BT's red and nailed 54-9 and 54-3 signs to BT's as needed.

Declination 20.

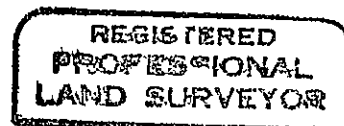

Larry D. Bishop

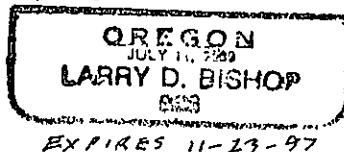

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 16 day of Aug, 1996
Robert D. Bayett by _____
(COUNTY OFFICIAL) (DEPUTY)