

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

INDEX No. G-17

History of original corner establishment:

Corner was originally established by Bamford Robb, in July 1880, under General Land Office Contract No. 357. The U.S. Surveyor Generals Notes State: Set basalt stone 12x8x6 in mound of stone for 1/4 sec. cor.

DIAGRAM



T15S R31E
1/4
S10: S11
1988
RLS 848

Description of corner evidence found:

Corner falls in a shallow draw bottom just south from Hwy. 395. No trace of the original stone is found. PLS 598, R.D. Bagett searched this corner in 1986, See Map of Survey No. 956. There are no accessories originally established. Corner was lost when the Highway was constructed. Set corner at proportionate measure between the Section corner as previously set at proportionate measure by R.D. Bagett in 1986, 1/mi. North and the Section corner as set at proportionate measure as a part of this survey, 1/2 mi. South.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set 2-1/2"x30" aluminum pipe with 3-1/2" aluminum cap, stamped as shown on the **DIAGRAM**, SET 24" in the ground.
From Which:
A Fir 16" dia., Bears S79°E., 38.6 ft., scribed: 1/4 S11 BT
A Fir 16" dia., Bears S62°W., 47.8 ft., scribed: 1/4 S10 BT
Measurements to trees taken with a metal tape and magnetic compass, with Declination set off 20 deg. East.
Nailed a brass washer stamped RLS 848 on blaze above BT scribe, Bearing Tree Sign above blaze, and warning sign on back of each tree. Painted a 6" red band at breast ht. around each tree. Set steel fence posts with warning & Boundary Signs, North 4 ft. and East from the corner.

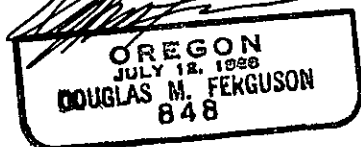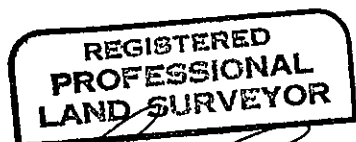

This work is performed by:
Douglas M. Ferguson PLS 848
Mt. Vernon Oregon.
On: April 27, 1988
Refer to Map of Survey No. 1038

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 28 day of Mar, 1989
Robert D. Baggett by _____
(COUNTY OFFICIAL) (DEPUTY)