

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

INDEX No. J-19
History of original corner establishment:

Corner was originally established by Bamford Robb, in July 1880, under General Land Office Contract No. 357. The U.S. Surveyor General's Notes State: Set basalt stone 16x8x6 with mound of stone for 1/4 sec. cor.

DIAGRAM

T15S R31E
S11
1/4--
S14
1908
PLS 848



Description of corner evidence found:

Corner falls in a steep east slope, no trace of the original stone or stone mound is identified.

There are no accessories originally established. Corner has apparently eroded out and rolled down the steep slope. Set the position at proportionate measure between the Section Corner found 1/2 mi. East and the Section Corner as established at proportionate measure by this survey 1/2 mi. West.

Description of monument and accessories established to perpetuate the original location of this corner:

Set 2-1/2"x30" aluminum pipe with 3-1/2" aluminum cap, stamped as shown on the **DIAGRAM**, SET 14" in the ground against base of rock outcrop and raised a stone mound around lower side of pipe.
From Which:
A Pine 10" dia., Bears S55°E., 23.1 ft., scribed: 1/4 S14 BT
A Fir 12" dia., Bears N21°E., 16.0 ft., scribed: 1/4 S11 BT
Measurements to trees taken with a metal tape and magnetic compass, with Declination set off 20 deg. East.
Nailed a brass washer stamped RLS 848 on blaze above BT scribe, Bearing Tree Sign above blaze, and warning sign on back of each tree. Painted a 6" red band at breast ht. around each tree. Set steel fence posts with warning & Boundary Signs, North & East 4 ft. from the corner.

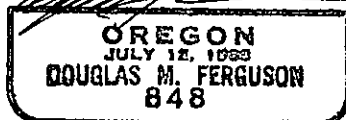

This work is performed by:
Douglas M. Ferguson PLS 848
Mt. Vernon Oregon.
On: May 2, 1988
Refer to Map of Survey No. 1038

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 28 day of May, 1989
Robert D. Dwyer by _____
(COUNTY OFFICIAL) (DEPUTY)