


CORNER RESTORATION

W $\frac{1}{4}$ cor.
CORNER Sec. 34 TWP 15 S. RANGE 31 E.

ORIGINAL SURVEY BY: Bamford Robb

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

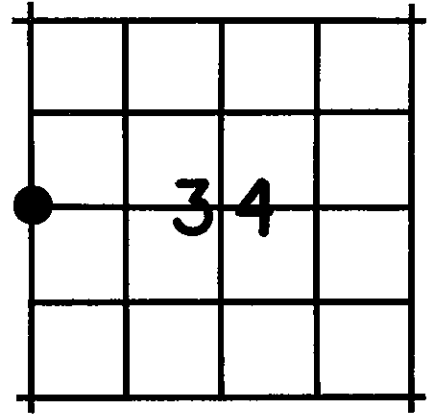

ORIGINAL DESCRIPTION:

North between Sections 33 and 34
Set basalt stone 15x10x5 ins. for $\frac{1}{4}$ section corner
from which:
A Pine 14 ins. diam. bears N. 40° W., 58 lks. dist.

RECEIVED AND
FILED

JUN 20 1986

OFFICE OF COUNTY SURVEYOR

Attest: *Robert D. Bagett*

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
M. D. Bagett

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1933
ROBERT D. BAGETT
598

May 27, 1986

Grant County Surveyor

EVIDENCE FOUND:

From the corner position:
A P. Pine 20 ins. diam., alive & well, bears N. 40° W., 38.3 feet, scribing visible.
measured to face of original BT.
I found no remains of corner stone, probably lost to logging activity in the area.
I established the corner position at record bearing & distance from the one
remaining BT.

See Record Map of Survey No. 938.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point, I set a 1 $\frac{1}{2}$ x30 inch galv. iron pipe,
26 ins. in the ground with attached brass cap marked as
shown, from which, I scribe a new BT:
A P. Pine 13 ins. diam. bears N. 43° E., 31.3 feet
marked $\frac{1}{4}$ S34 CSBT.

Nailed brass washer marked OPLS 598 to lower blaze of new
BT's. Painted 6" red band around new BT's above blaze and
on blaze and attached BT signs and warning signs to BT's.
Set steel fence posts approx. 5 feet North from monument
and attached appropriate signs. Used magnetic compass with
19° E. var. and steel tape measuring to a 40d nail driven
in side center at root crown of new BT's.

MONUMENT MARKED

