


CORNER RESTORATION

CORNER ^{SE corner} Sec. 31 TWP 15 S RANGE 31 E

ORIGINAL SURVEY BY: A. O. Ecelson

CONTRACT NUMBER: 328

CONTRACT DATE:

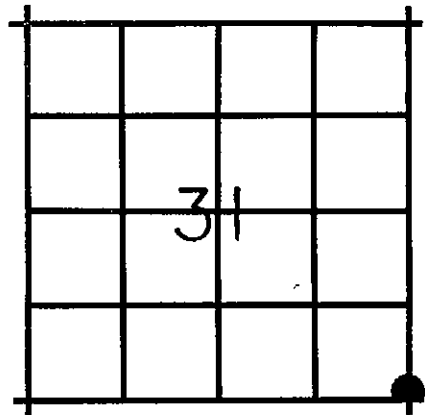



ORIGINAL DESCRIPTION:

80.00 set post for corner to Secs. 31 and 32, from which
A pine 14 inches in diam. bears N. 45° W., 44 lks. dist.
A pine 20 inches in diam. bears N. 39° E., 58 lks. dist.

RECEIVED AND
FILED

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
W. A. Potridge

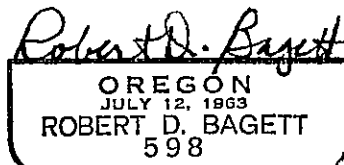

AUG 11 1981

OFFICE OF COUNTY SURVEYOR

Attest: *Carol Baggett*
Co. Clerk

June 26, 1981

Grant County Surveyor

EVIDENCE FOUND:

I did not find the original corner post. The post was probably lost to heavy logging operations in this area. I established the position of this corner at record bearing and distance from the remains of the two original Bearing Trees as follows: from the corner point:

A fast deteriorating 20 inch pine stump which still has the blaze but is unmarked bears N. 39° E. 38.3 feet; blazed and notched, blaze faces S. 10° E.

The root of a decayed, dead, and down pine approx. 14 inches in diam. bears N. 25° W., 29.0 ft. no marks remain.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point:

Set a 1½"x30" galvanized iron pipe 24" in the ground with brass cap marked as shown.
from which I scribe NEW BEARING TREES:

A pine 10" in diam. bears N. 35° E., 26.1 ft. marked T15SR31ES32SC CSBT.

A pine 12" in diam. bears N. 52° W., 44.3 ft. marked T15SR31ES31SC CSBT.

Used magnetic compass with 18° East variation and steel tape, measuring to face of blaze.

MONUMENT MARKED

